

41

weekly notice

Monday, 5 October 2026

Sunday, 11 October 2026

RailSafe



See online for all Safeworking Information

www.railsafe.org.au

Safeworking information, including Weekly Notices and SAFE Notices, is available on the RailSafe website.

By accessing Weekly Notices and SAFE Notices online, you will receive safety information more quickly. Weekly Notices remain on the RailSafe website for two years; Permanent and Temporary SAFE Notices remain online as long as they are current.

Anyone needing back issues of Weekly Notices and SAFE Notices should contact the Network Rules unit.

If you are outside Sydney Trains, you can reach the RailSafe website via the following address:

www.railsafe.org.au

Other Safeworking documents, such as Network Rules, Network Procedures, Network Local Appendices, Safeworking Policies, SafeTracks flyers, and contractor information are also available online.

**Director Network Standards, Systems and Quality
Sydney Trains**

CONTENTS

PUBLICATION DEADLINES AND SUBMISSION OF ARTICLES	4
MORISSET (NORTH) – MORISSET AND VALES POINT RE-SIGNALLING FINAL SIGNALLING WORKS – AMENDED NOTICE (DIAGRAM)	5
TURRELLA & WOLLI CREEK – PROVISION OF WOLO BOARDS	16
REGIONAL INFRASTRUCTURE UPGRADES – NEW INTERCITY FLEET PROJECT - REGIONAL RAIL PHASE 2 – BUNDLE A - INSTALLATION & COMMISSIONING OF NEW "3R" AND "6R" PLATFORM CARMARKERS AT BROADMEADOW, FASSIFERN, GOSFORD, HORNSBY AND WYONG STATIONS.	17
REDFERN (WELLS STREET) STAGE 2 - RENEWAL OF 642A & 644A POINTS TO "A" UNIT WITH IN-BEARER SPHEROLOCK AND POINT CONDITION MONITORING (DIAGRAM)	22
REGIONAL RAIL/NEW INTERCITY FLEET INFRASTRUCTURE UPGRADES - SOUTH COAST LINE -STAGE 10B – CORRIMAL (ILLAWARRA) – RELOCATION OF SIGNAL WG503U & SPEED BOARD CHANGE (DIAGRAM)	24
COCKLE CREEK (NORTH) STAGE 1 – REMOVAL OF 110, 111 TURNOUTS & CATCHPOINTS AND 112 CROSSOVER (DIAGRAM)	25
REGIONAL RAIL/NEW INTERCITY FLEET INFRASTRUCTURE UPGRADES - REGIONAL RAIL PHASE 01 - BOWENFELS (WEST) – COMMISSIONING OF ATP CHANGES, NEW BEGIN AND END ATP SIGNS (DIAGRAM)	27
STATUS OF TOM NOTICES	29
STATUS OF PERMANENT SAFE NOTICES	31
STATUS OF NETWORK MANUALS AND FORMS	32
DISTRIBUTION OFFICERS	34

PUBLICATION DEADLINES AND SUBMISSION OF ARTICLES

Dates of the next three Weekly Notices and deadlines for articles are:

<i>Weekly Notice</i>	<i>For Week</i>	<i>Deadline</i>
42	12/10/2026 – 18/10/2026	08/09/2026
43	19/10/2026 – 25/10/2026	15/09/2026
44	26/10/2026 – 01/11/2026	22/09/2026

To meet printing and distributing schedules, articles for a Weekly Notice must be received by its deadline.

Articles submitted after a deadline will be published in the next issue of the Weekly Notice. This may result in information not being distributed in time for it to be acted upon.

When submitting articles, please include your name, position title, telephone numbers and email address at the end of the articles as shown below:

Steve Swanson

Network Rules Specialist

Mob: 0428 416 505

Email: STEPHEN.SWANSON@transport.nsw.gov.au

MORISSET (NORTH) – MORISSET AND VALES POINT RE-SIGNALLING FINAL SIGNALLING WORKS – AMENDED NOTICE

The notice and accompanying Drivers Diagram for Morisset and Vales Point Re-signalling in WN-39 and WN-40 is republished here with corrected name of the balloon loop at Vales Point, and with corrected MT17 CO-ACTING signal route indication.

Commencing at 0200 hours on **Saturday, 03 October 2026**, and continuing until 2300 hours on Monday, 05 October 2026, the following works will be carried out:

The existing Morisset mechanical interlocking and Vales Point relay interlocking will be decommissioned, along with the Morisset indication panel and Vales Point control panel located in Morisset signal box.

The new interlocking will be remotely controlled from the ATRICS Central Coast workstation presently located at Gosford.

In conjunction with this work, existing mechanical crossovers at Morisset will be decommissioned and new crossovers will be brought into use. A new Perway Siding at Morisset will also be brought into use.

A Drivers Diagram showing the new arrangements appears in this Weekly Notice.

Line side Infrastructure Alterations

The following tables summarise all signals, signs, points and guard's indicators within the resignalled area. Refer also to the Drivers Diagram for the new arrangements.

Signals

Signal / km	Route	Designation	Route Indication	Remarks
69.7 112.251 km	(M)	Auto, Down Main	-	Existing signal, medium aspect (PY) removed.
71.1 114.347 km	(M)	Auto, Down Main		Existing signal unchanged
71.2 114.650 km	(M)	Auto, Up Main		Existing signal unchanged
V1 115.943 km	(M)	<i>Vales Point Down Accept, Down Main</i>	-	<i>Signal and ATP trainstop removed.</i>
72.4 116.305 km	(M)	Auto, Up Main	-	Signal renewed approximately 4m towards Sydney. Trainstop provided. New Yard Limit signs provided.
MT1 116.348 km	(M)	Morisset Down Accept, Down Main	-	New signal and trainstop. New Yard Limit signs provided.
V3	(M)	<i>Down Home Balloon Loop to Down Main</i>	-	<i>Signal removed.</i>
MT3 121.964 km *	(M)	Down Home, Balloon Loop to Down Main	-	New signal. * km measured via balloon loop
	(S)	Shunt, Balloon Loop to Down Main	-	
V5 118.892 km	(M)	<i>Down Home, Down Main</i>	-	<i>Signal and ATP trainstop removed.</i>

Signal / km	Route	Designation	Route Indication	Remarks
MT5 119.046 km	(M)	Down Home, Down Main	-	New signal and trainstop.
	(S)	Shunt, Down Main	-	
MT6 119.328km	(M)B	Up Home Starter, Up Main	-	New signal and trainstop. Medium aspect provided.
	(S)A	Shunt, Up Main to Balloon Loop	BL	
	(S)B	Shunt, Up Main	UM	
V6 119.342 km	(S)A	<i>Shunt, Up Main to Balloon Loop</i>	-	<i>Signal and ATP trainstop removed.</i>
	(M)B	<i>Up Home Starter, Up Main</i>	-	
MT7 121.131 km	(M)	Down Home, Down Main	-	New signal and trainstop. Medium aspect and Turnout Repeater provided.
MT8 121.201 km	(M)	Up Home, Up Main	-	New signal and trainstop. Medium aspect provided.
V8 121.372 km	(M)	<i>Up Accept, Up Main</i>	-	<i>Signal and ATP trainstop removed.</i>
75.5 121.525 km	(M)	<i>Morisset Down Accept, Down Main</i>	-	<i>Signal and trainstop removed.</i>
MT11 122.768 km	(M)A	Down Home, Down Main	-	New signal and trainstop. Medium aspect provided.

Signal / km	Route	Designation	Route Indication	Remarks
	(M)B	Up Main	RH BOL	Medium Turnout aspect provided.
	(S)A	Shunt, Down Main	DM	
	(S)B	Shunt, Up Main	UM	
76.5 123.125 km	(M)	Down Home, Down Main	-	Signal and trainstop removed.
MT12 123.139 km	(M)A	Up Home, Up Main	-	New signal and trainstop. Medium aspect provided.
	(S)A	Shunt, Up Main	UM	
	(S)B	Shunt, Up Main to Down Main	DM	
76.6 123.260 km	(M)	Up Starter, Up Main	-	Signal and trainstop removed.
7/8 123.408 km	(S)A	Shunt, Up Main to Down Main	DM	Signal removed.
	(S)B	Shunt, Up Main to Perway Siding	UR	
76.7 123.410 km	(M)	Down Home, Down Main	-	Signal and trainstop removed.
MT15 123.420 km	(M)	Down Home, Down Main	-	New signal and trainstop.
	(S)	Shunt, Down Main	-	

Signal / km	Route	Designation	Route Indication	Remarks
MT17 123.434 km	(M)A	Down Home, Up Main to Down Main	LH BOL	New signal and trainstop. Medium Turnout aspect provided.
	(S)A	Shunt, Up Main to Down Main	DM	
	(S)C	Shunt, Up Main to Perway Siding	PS	
MT17 CO-ACTING 123.434 km	(M)A	Up Main to Down Main	DM	New signal.
	(S)A	Shunt, Up Main to Down Main	DM	
	(S)C	Shunt, Up Main to Perway Siding	PS	
15 123.479 km	(S)	<i>Shunt, Down Main to Up Main</i>	UM	<i>Signal removed.</i>
MT22 123.550 km	(S)	Shunt, Perway Siding to Up Main	-	New signal.
76.8 123.579 km	(M)	<i>Up Home, Up Main</i>	-	<i>Signal and trainstop removed.</i>
R76.8 123.579 km	(M)	<i>Up Home, Perway Siding to Up Main</i>	-	<i>Signal removed.</i>

Signal / km	Route	Designation	Route Indication	Remarks
MT24 123.970 km	(S)A	Shunt, Down Main to Up Main	UM	New signal.
	(S)B	Shunt, Down Main	DM	
MT26 124.120 km	(M)	Up Home, Up Main	-	New signal and trainstop. Medium aspect provided.
	(S)	Shunt, Up Main	-	
77.2 124.181 km	(M)	<i>Up Home, Up Main</i>	-	<i>Signal and trainstop removed.</i>
77.3 124.210 km	(M)	<i>Down Starter, Down Main</i>	-	<i>Signal and ATP trainstop removed.</i>
MT29 124.998 km	(M)	Down Starter, Down Main	-	New signal and trainstop.
77.8 125.200 km	(M)	<i>Morisset Up Accept, Up Main</i>	-	<i>Signal and trainstop removed.</i>
MT30 125.265 km	(M)	Morisset Up Accept, Up Main	-	New signal and trainstop. Medium aspect provided. New Yard Limit signs provided.
78.8 126.888 km	(M)	Auto, Up Main	-	Existing Signal new medium aspect provided. Existing Sign TONNAGE replaced with new sign written: TONNAGE SIGNAL TRAINS OF OVER PRESCRIBED LOAD ARE TO WAIT UNTIL SIGNAL IS AT FULL CLEAR

Points (Refer to Drivers Diagram for positioning of EOL/ESML)

Points Number	Designation	Emergency	Remarks
		Operation Points	
MT50 (OLD V21)	Turnout Vales Point Balloon Loop	EOL	Existing Turnout renamed
MT51A/B (OLD V22A/B)	Turnout and Catchpoint Up Main to Vales Point Balloon Loop	EOL	Existing Turnout and Catchpoint renamed
MT52A/B (OLD V23A/B)	Crossover Up Main to Down Main	EOL	Existing Crossover renamed
MT53A/B	40km/h Crossover Down Main to Up Main	EOL	New crossover previously installed but booked out, brought into use
Frame D	Crossover Down Main to Up Main	-	Existing Frame D removed
12	Crossover Down Main to Up Main	-	Existing crossover removed
MT55A/B	Turnout and Catchpoint Up Main to Perway Siding	EOL	New crossover previously installed but booked out, brought into use
MT56A/B	40km/h Crossover Up Main to Down Main	EOL	New crossover previously installed but booked out, brought into use

Emergency Operation of Points

EOLs are Fortress key type for unlocking hand-throw levers on the points machines.

Perway Siding

The new Perway Siding will be 446m in length. A buffer stop, with buffer stop light, is provided at the end of the siding. The Perway Siding is not wired for electric traction.

Guard's Indicators

Guard Indicators	Designation	Remarks
12 GI	Morisset Platform 1 Up Main Up Direction	1 GI operating in conjunction with MT12 Signal
15(1) GI and 15(2) GI	Morisset Platform 2 Down Main Down Direction	2 x GIs operating in conjunction with MT15 Signal
17 GI	Morisset Platform 1 Up Main Down Direction	1 GI operating in conjunction with MT17 Signal
<i>Dn GI</i>	<i>Morisset Platform 2 Down Main Down Direction</i>	<i>Existing GI removed</i>
<i>Up Platform Dn GI</i>	<i>Morisset Platform 1 Up Main Down Direction</i>	<i>Existing GI removed</i>

Signage

Sign	Location (approx.)	Remarks
'SKS LIMIT DOWN MAIN NORTH SIGNAL 66.9 TO	On 66.9 Signal Post	

Sign	Location (approx.)	Remarks
SIGNAL MT1'		
'YOU ARE LEAVING VALES POINT PRIVATE RAILWAY BEYOND THIS POINT SYDNEY TRAINS STANDARDS APPLY'	Adjacent to MT3 signal	
'YOU ARE ENTERING VALES POINT PRIVATE RAILWAY'	Vales Point Balloon Loop, Up Direction, after MT50 points	
Pantograph Sign	Up Main near MT51B points	Existing Sign
Shunting Limit	Up Direction on Down Main, approx 490m Sydney side of MT11 signal	RHS of line
Shunting Limit	Up direction on Down Main, Sydney side of Platform 2	RHS of line
Points Cleared 10 Cars	Down Main, approx 215m Country side of MT24 signal	
Pantograph Sign	Down direction on Up Main, near MT55A points	RHS of line
"TONNAGE SIGNAL TRAINS OF OVER PRESCRIBED LOAD ARE TO WAIT UNTIL SIGNAL IS AT FULL CLEAR"	At 78.8 signal	Existing sign replaced with new

Automatic Train Protection

The existing ATP equipment will be altered as required to suit the new track and signalling arrangements.

Telephones

A telephone will be provided at new MT3 signal, and at each EOL location. All new telephones in the Morisset resignalling area will be arranged to connect to the Central Coast ATRICS workstation.

Telephones will not be provided on the other new / renewed signals.

Axle Counters

Rail Vehicle Detection within the Vales Point and Morisset area is by axle counter for the tracks:

On the Down Main, (MT)1AT to (MT)29AT inclusive

On the Up Main, (MT)30AT to (MT)6DT inclusive

On the Vales Point Balloon Loop, (MT)A3AT and (MT)3AT

On the Perway Siding, (MT)PSAT

Intervals between Train Movements

The rules in NGE 220 Unreliable track-circuit operation are applicable to axle counter tracks, except for treating a track that has not been used for a 72-hour period as unreliable.

Axle counters are unaffected by railhead contamination and do not require frequent traffic to provide railhead cleaning. Axle counter tracks are exempt from this 72-hour requirement.

Axle Counter Resets

In certain situations, axle counters require resetting. Reset functionality has been provided on the signaller's workstation. Instructions and requirements for resetting axle counters will be detailed in the Network Local Appendix NLA 314 and the Signalling Safeworking procedures.

Rail Traffic with Unreliable Detection

If it is anticipated a vehicle will leave an axle counter track in a miscounted state, arrangements may need to be made with the signals maintenance representative to determine what site support is needed.

Vales Point Siding Maintenance Isolation Switch

Vales Point Siding Maintenance Isolation Switch will be provided adjacent to the

MT50 / MT51 / MT52 EOLs. The Isolation Switch allows MT51 points to be isolated in the Normal position by the private siding maintenance personnel. The switch is secured by a lock, only the Vales Point siding maintainers have the key.

VER 15092026**Diagram VER 15092026****Randall Dower**

Commissioning Manager Signalling, Sydney Trains

Mob: 0418593909

Email: Randall.Dower@transport.nsw.gov.au

Mahendran Maruthanayagam


Design Delivery Manager, JMDR

Mob: 0430500547

Email: mahendran.m@jmdr.com

SIGNAL KEY SWITCH

LOC	WARDING	SIGNAL	INSCRIPTION
66.9	WSK	66.9	66.9 DN MAIN NORTH

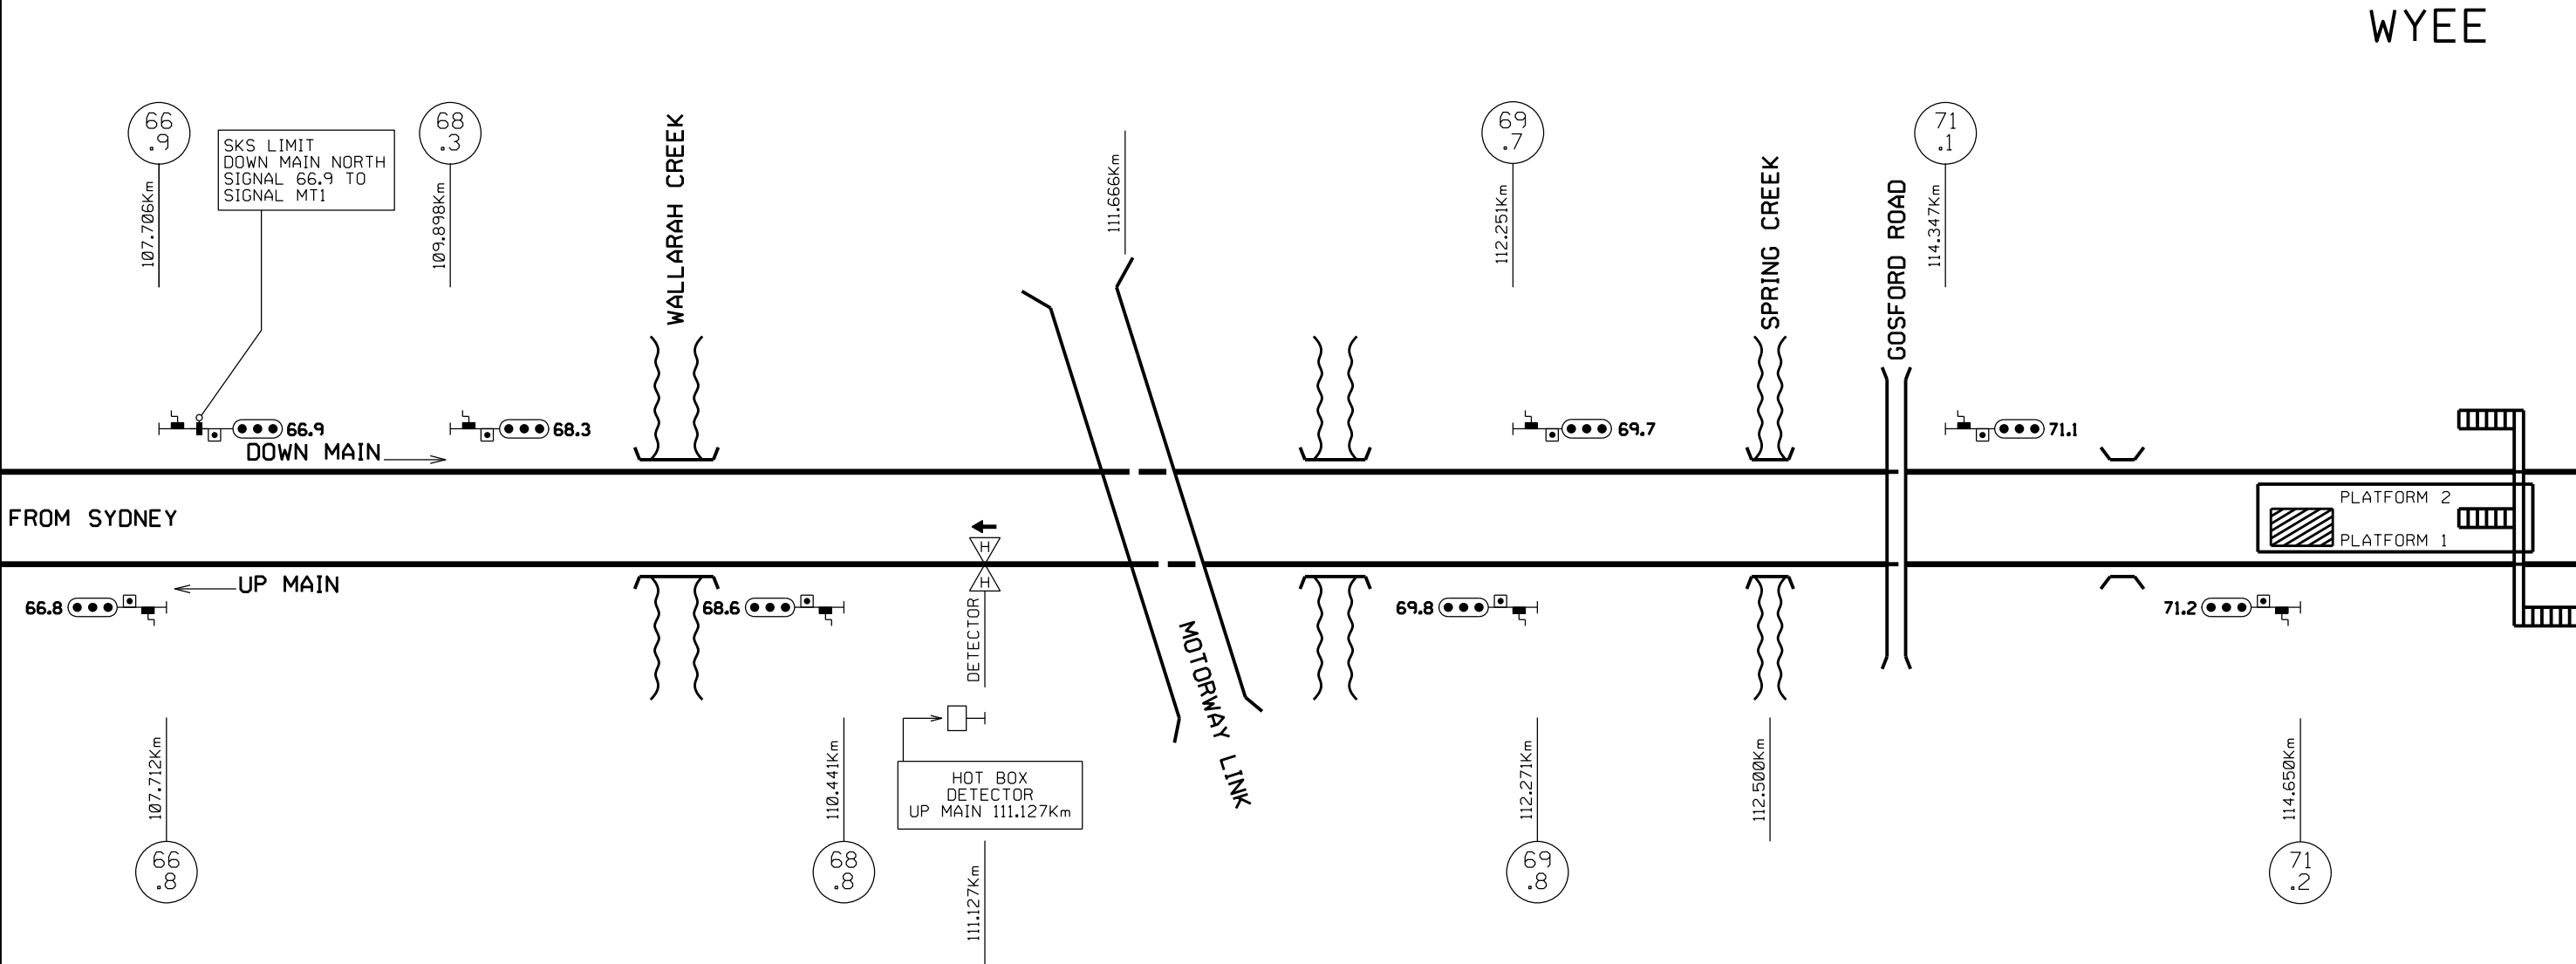


Transport
for NSW


MORISSET

MORISSET AND VALES POINT RESIGNALLING
DRIVERS DIAGRAM SHEET 1 OF 4

Produced by JMDR

VER. 15/09/2026

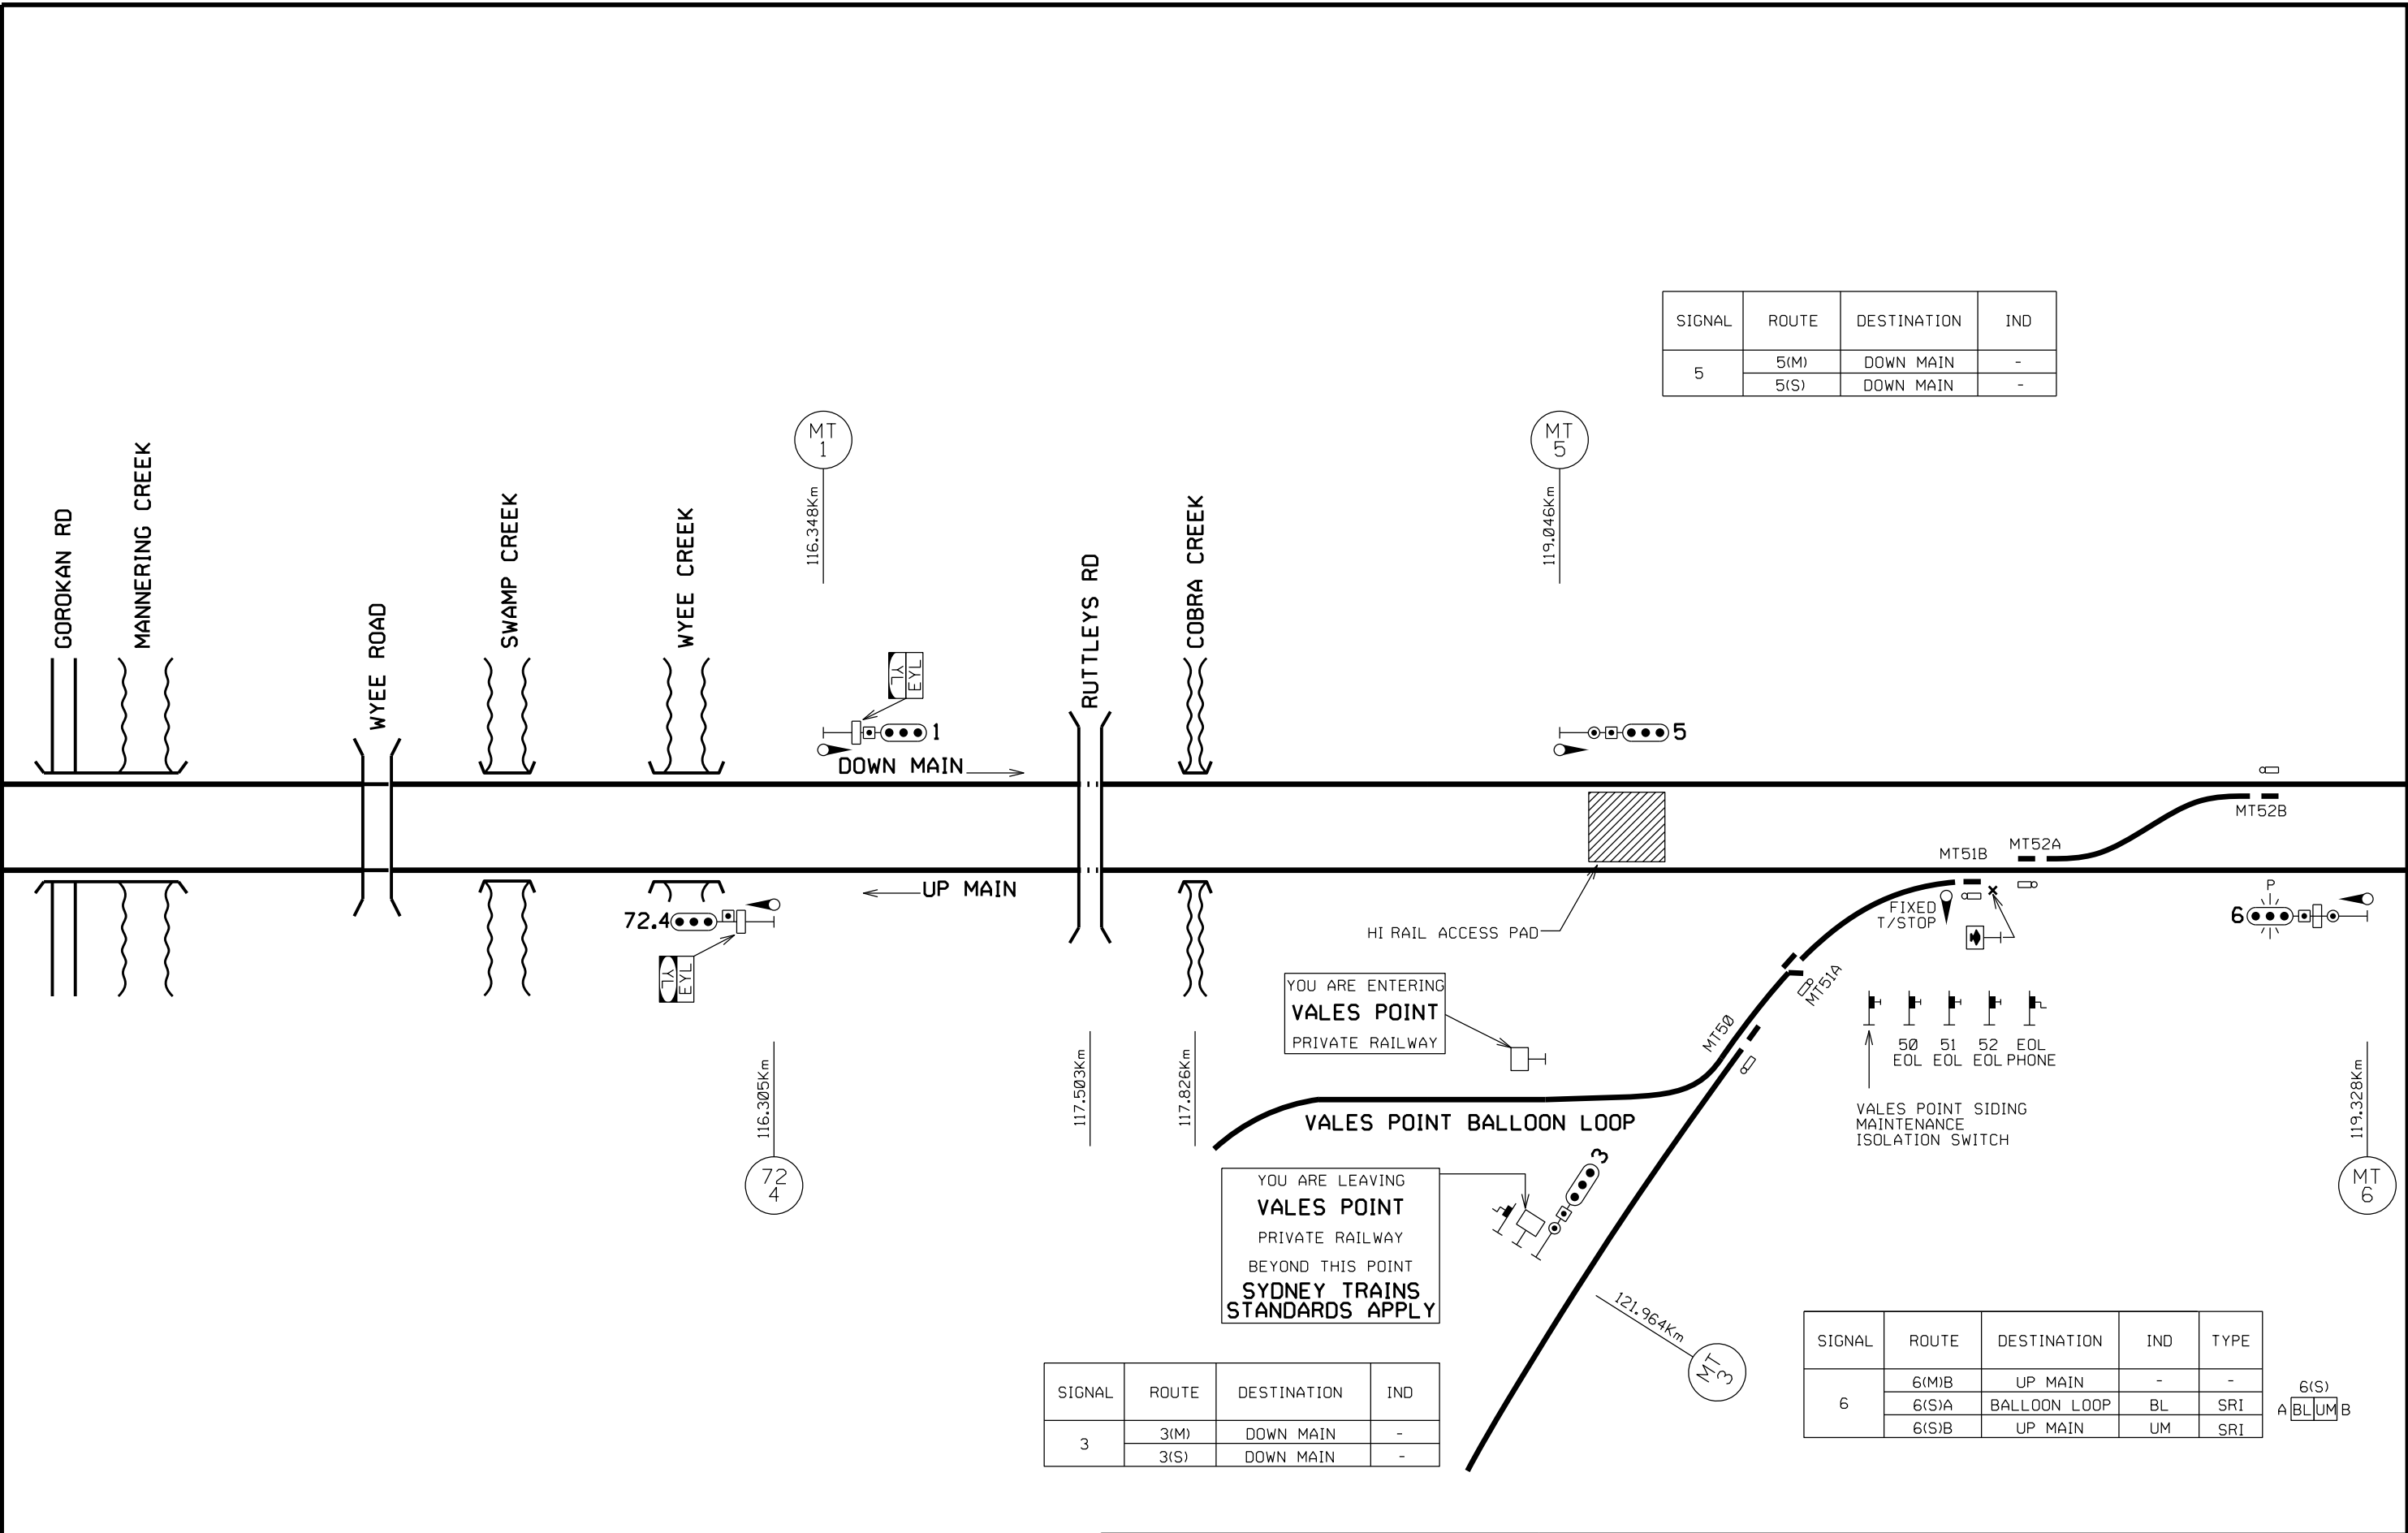

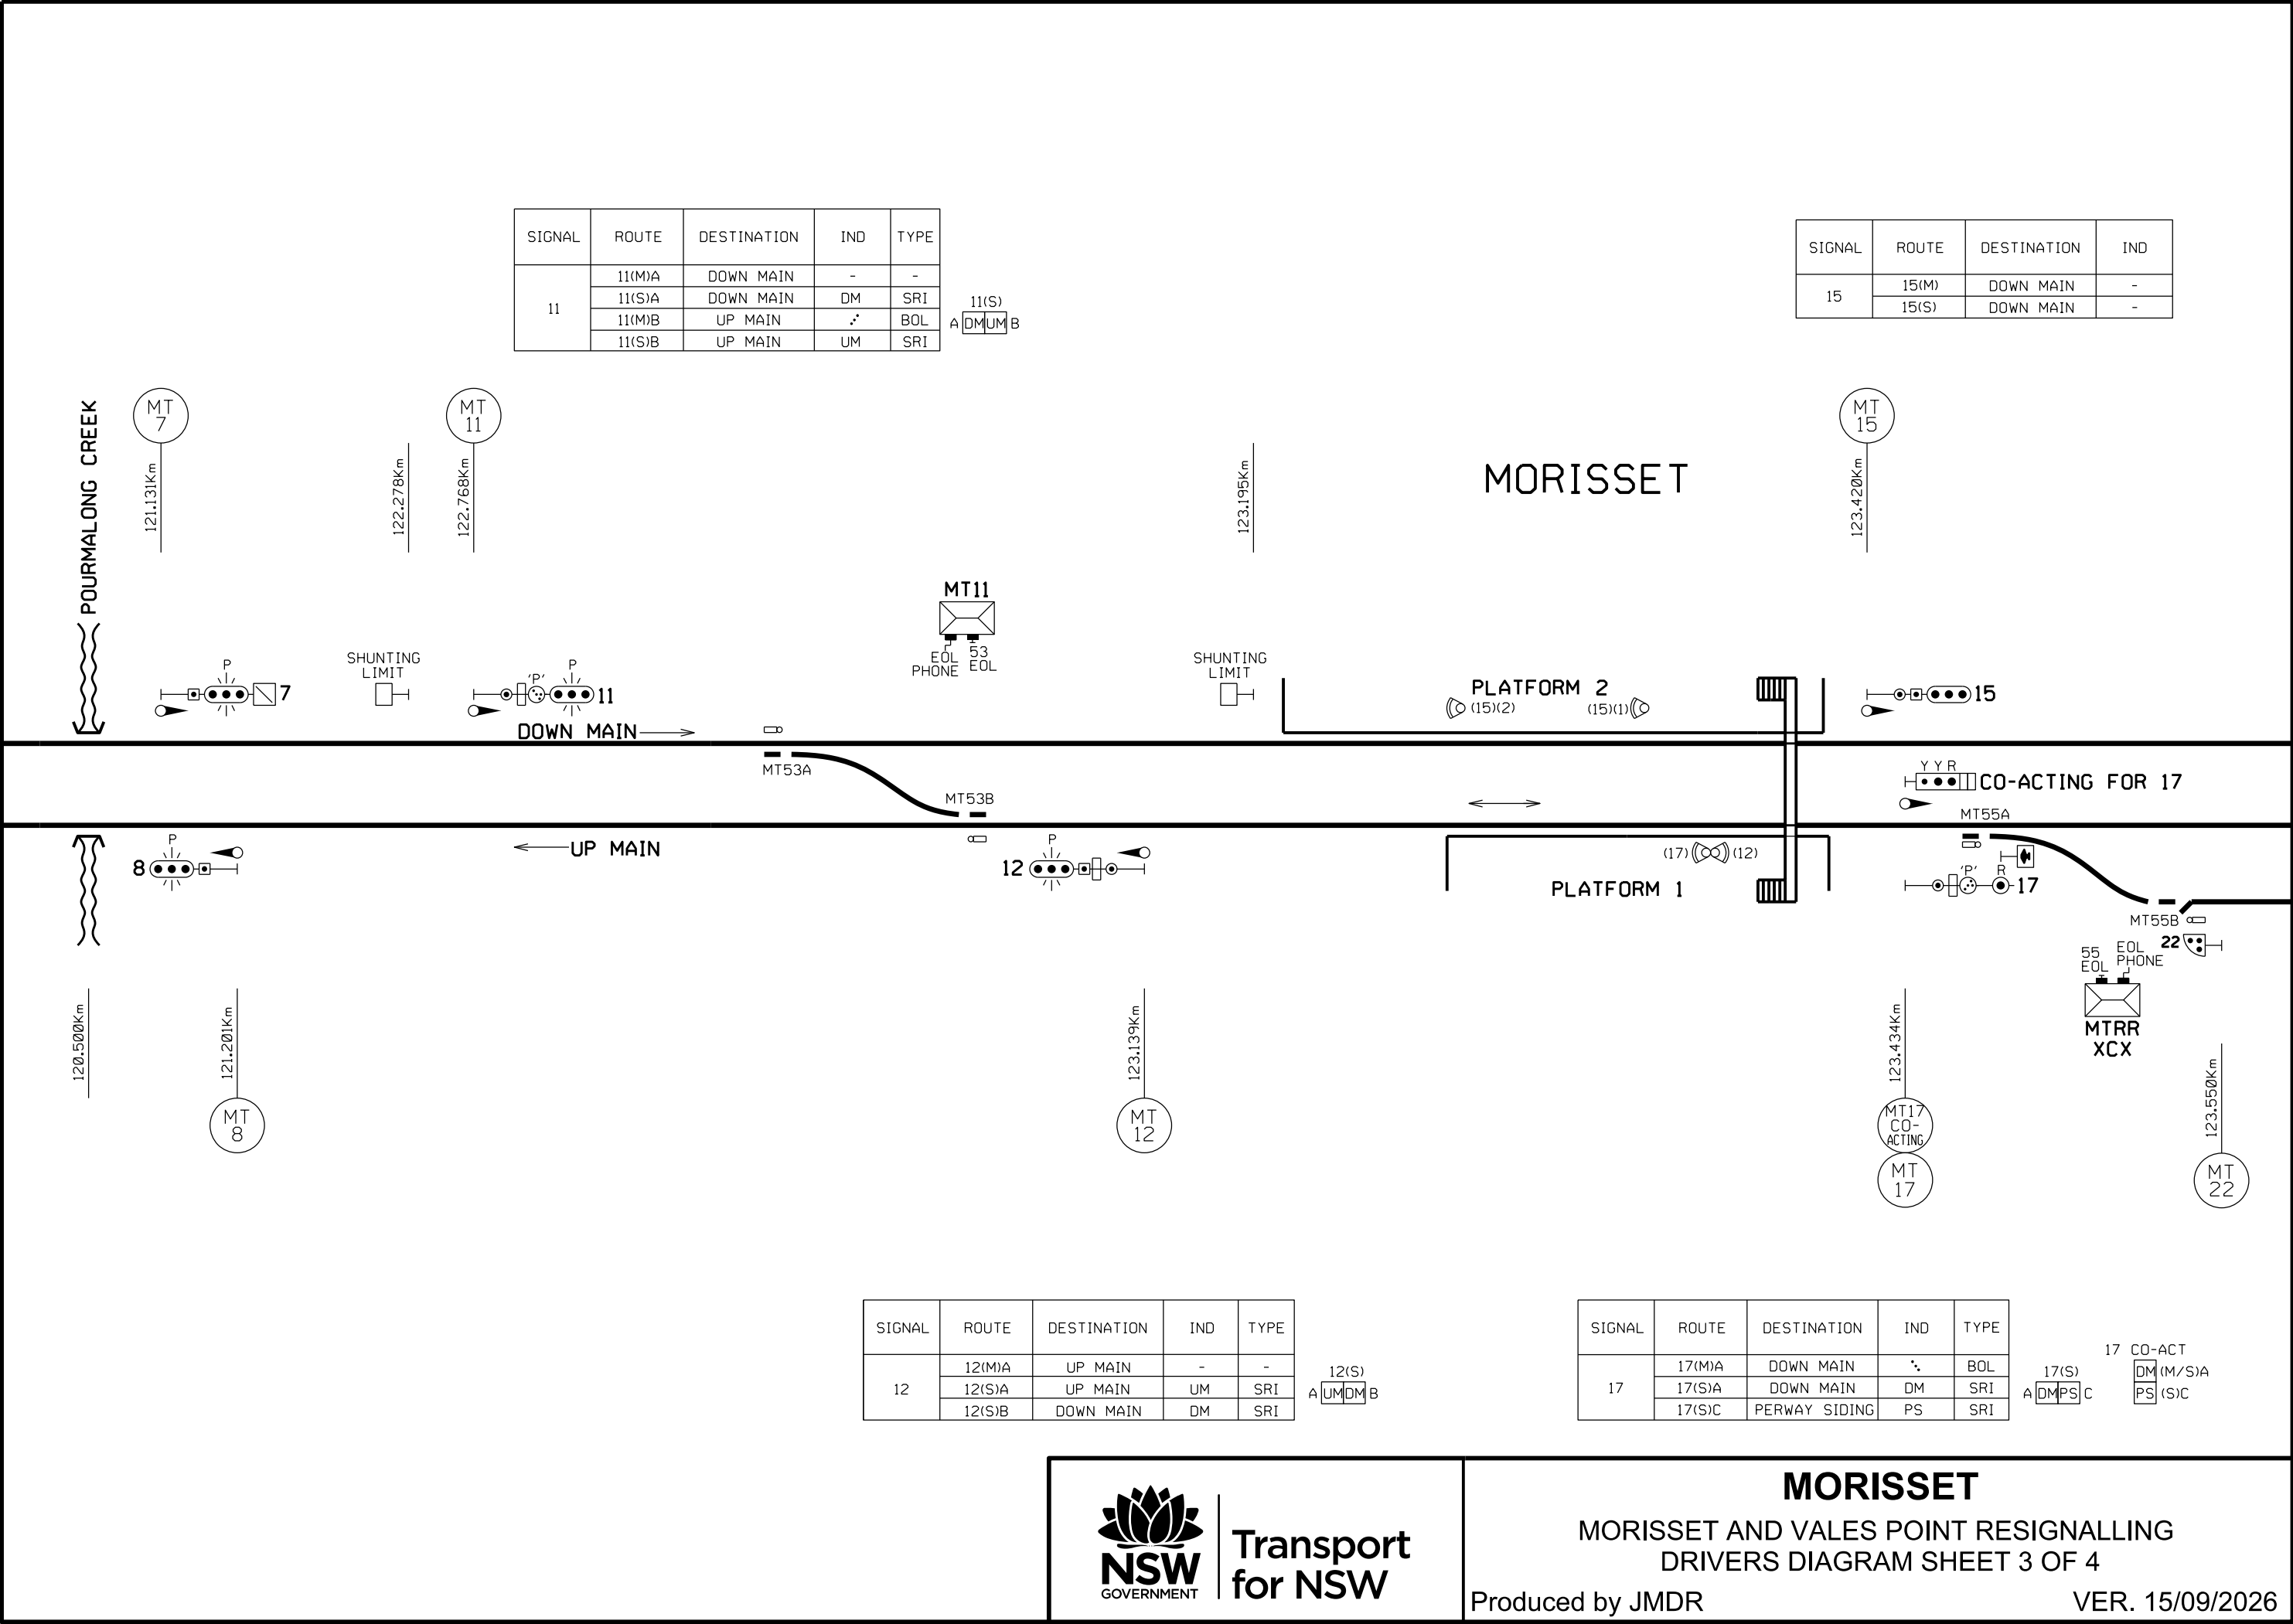

SIGNAL	ROUTE	DESTINATION	IND	TYPE
11	11(M)A	DOWN MAIN	-	-
	11(S)A	DOWN MAIN	DM	SRI
	11(M)B	UP MAIN	.	BOL
	11(S)B	UP MAIN	UM	SRI

11(S)
A DMUM B

SIGNAL	ROUTE	DESTINATION	IND
15	15(M)	DOWN MAIN	-
	15(S)	DOWN MAIN	-

SIGNAL	ROUTE	DESTINATION	IND	TYPE
12	12(M)A	UP MAIN	-	-
	12(S)A	UP MAIN	UM	SRI
	12(S)B	DOWN MAIN	DM	SRI


12(S)
A UMDM B

SIGNAL	ROUTE	DESTINATION	IND	TYPE
17	17(M)A	DOWN MAIN	.	BOL
	17(S)A	DOWN MAIN	DM	SRI
	17(S)C	PERWAY SIDING	PS	SRI

17 CO-ACT
17(S) DM (M/S)A
A DMPS C PS (S)C



Transport
for NSW

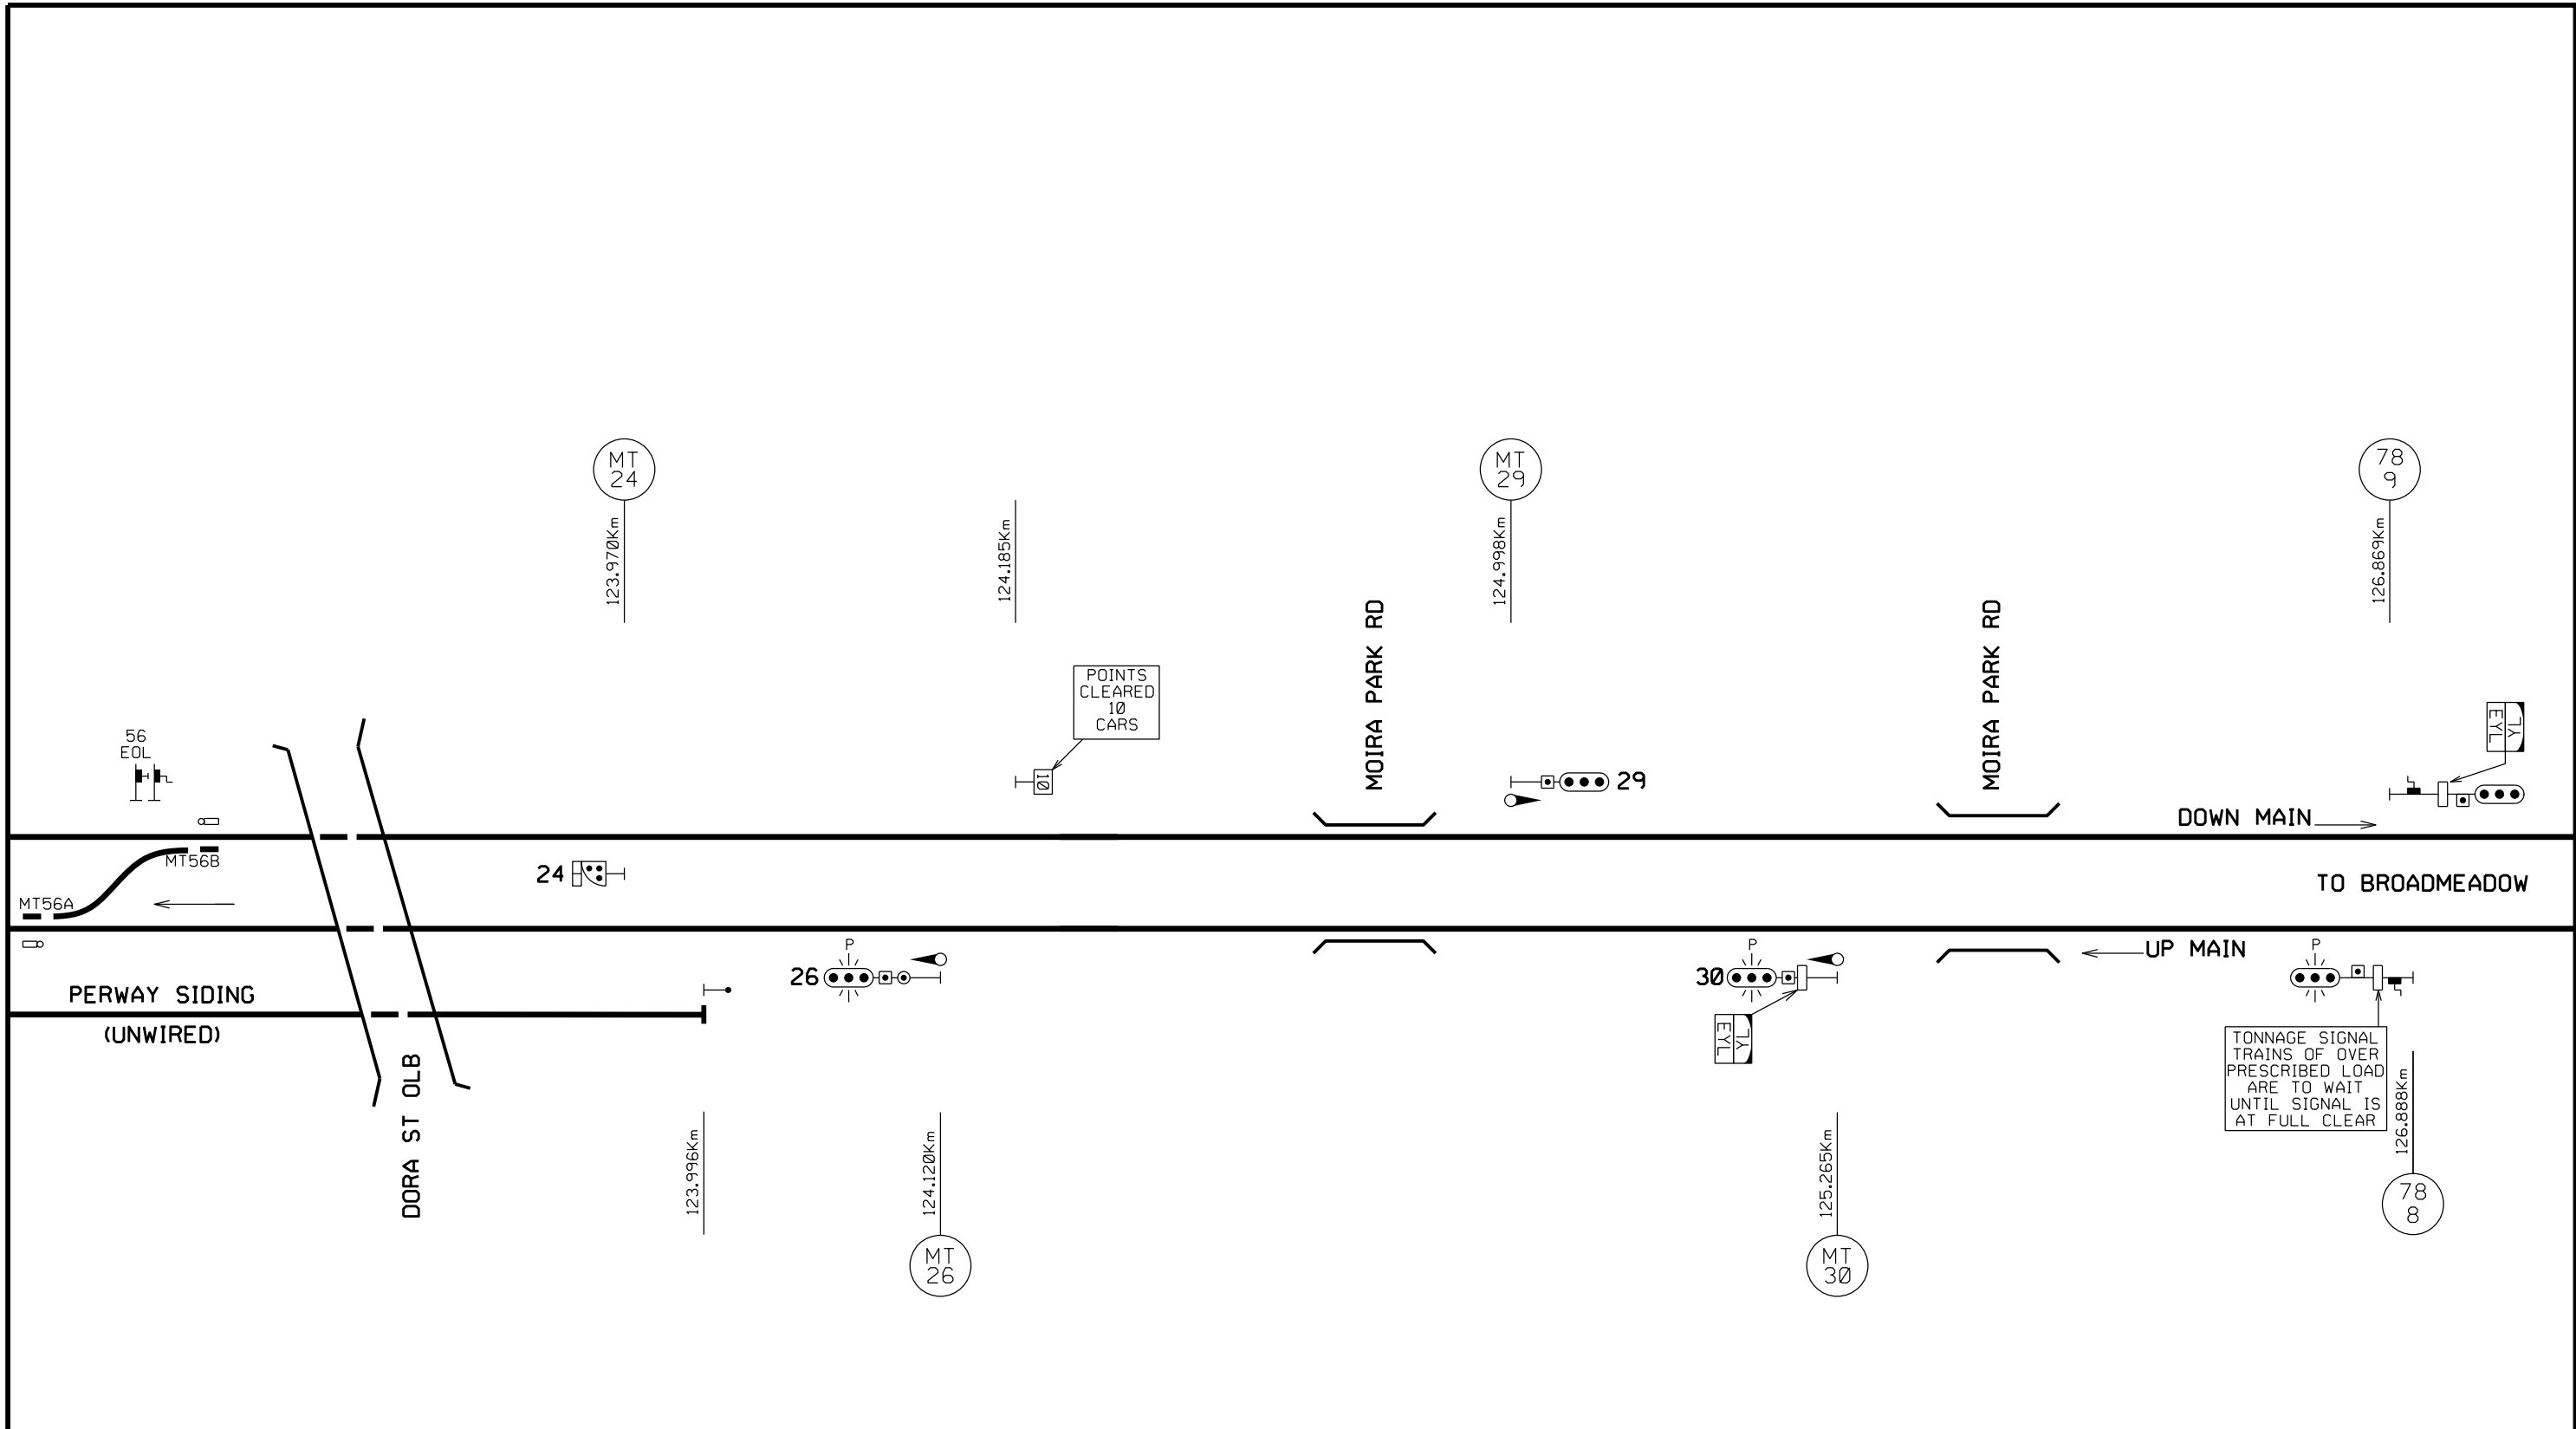

SIGNAL	ROUTE	DESTINATION	IND	TYPE
24	24(S)A	UP MAIN	UM	SRI
	24(S)B	DOWN MAIN	DM	SRI

24(S)
A U M D M B

SIGNAL	ROUTE	DESTINATION	IND
26	26(M)	UP MAIN	-
	26(S)	UP MAIN	-



Transport
for NSW

MORISSET

MORISSET AND VALES POINT RESIGNALLING
DRIVERS DIAGRAM SHEET 4 OF 4

Produced by JMDR

VER. 15/09/2026

TURRELLA & WOLLI CREEK – PROVISION OF WOLO BOARDS

Commencing on **Friday, 16 October 2026**, the following WOLO boards will be installed;

- East Hills Up Main at Turrella on Structure TE 8+404 at approximately 8.398km
- East Hills Up Local on city end of Turrella Station Platform 1
- Down Airport, on country end of Wolli Creek Station Platform 2
- East Hills Down Main at Wolli Creek on Structure TE7+435 at approximately 7.440km

VER21092026

Network Maintenance, Engineering and Maintenance

Andrew Gray

Regional Track Engineer – South Region

Mob: 0427 395 199

Email: andrew.gray@transport.nsw.gov.au

REGIONAL INFRASTRUCTURE UPGRADES – NEW INTERCITY FLEET PROJECT - REGIONAL RAIL PHASE 2 – BUNDLE A - INSTALLATION & COMMISSIONING OF NEW "3R" AND "6R" PLATFORM CARMARKERS AT BROADMEADOW, FASSIFERN, GOSFORD, HORNSBY AND WYONG STATIONS.

Since 1800 hours on **Friday, 18 September 2026**, the following works have been completed,

- New "3R" and "6R" platform carmarkers required for the Regional Rail Fleet were installed on the following station platform coping or end fence,
 - Broadmeadow (1,2,3)
 - Fassifern (1,2)
 - Gosford (1,2,3)
 - Hornsby (3,4,5)
 - Wyong (1,2,3)

Refer to table 01 for details

Station	Platform	Carmarker changes
Broadmeadow	1 Sydney End	New '3R'carmarker painted on coping approx. 117.724m from fence. New '6R' carmarker painted on coping approx. 69.564m from fence.
Broadmeadow	1 Country End	New '3R'carmarker painted on coping approx. 115.409m from fence. New '6R' carmarker painted on coping approx. 91.329m from fence.
Broadmeadow	2 Country End	New '3R'carmarker painted on coping approx. 24.079m from fence. New '6R' carmarker installed on fence.
Broadmeadow	3 Sydney End	New '3R'car marker painted on coping approx.54.158m from fence. New '6R' carmarker painted on coping approx.5.996m from fence.
Broadmeadow	3 Country End	New '3R'carmarker painted on coping approx.57.708m from fence. New '6R' carmarker painted on coping approx. 33.628m from fence.
Fassifern	1 Sydney End	New '3R'carmarker painted on coping approx.133.786m from fence. New '6R' carmarker painted on coping approx. 52.368m from fence.
Fassifern	2 Country End	New '3R'car marker painted on coping approx.38.320m from fence. New '6R' carmarker painted on coping approx. 14.579m from fence.
Gosford	1 Sydney End	New '3R'car marker painted on coping approx.96.173m from fence. New '6R' car marker painted on coping approx.48.012m from fence.
Gosford	1 Country End	New '3R'car marker painted on coping approx. 39.194m from fence. New '6R' carmarker painted on coping approx. 15.113m from fence.
Gosford	2 Sydney End	New '3R'car marker painted on coping approx. 82.043m from fence. New '6R' carmarker painted on coping approx. 57.964m from fence.

Gosford	2 Country End	New '3R' car marker painted on coping approx. 54.783m from fence. New '6R' car marker painted on coping approx. 6.623m from fence.
Gosford	3 Sydney End	New '3R' car marker painted on coping approx. 68.362m from fence. New '6R' car marker painted on coping approx. 67.912m from fence.
Gosford	3 Country End	New '3R' car marker painted on coping approx. 46.800m from fence. New '6R' car marker painted on coping approx. 51.778m from fence.
Hornsby	3 Sydney End	New '3R' car marker painted on coping approx. 121.755m from fence. New '6R' car marker painted on coping approx. 73.595m from fence.
Hornsby	3 Country End	New '3R' car marker painted on coping approx. 47.808m from fence. New '6R' car marker painted on coping approx. 23.728m from fence.
Hornsby	4 Sydney End	New '3R' car marker painted on coping approx. 85.199m from fence. New '6R' car marker painted on coping approx. 37.039m from fence.
Hornsby	4 Country End	New '3R' car marker painted on coping approx. 66.714m from fence. New '6R' car marker painted on coping approx. 42.634m from fence.

Table 1 – New platform Carmarkers Cont.

Station	Platform	Carmarker changes
Hornsby	5 Country End	New '3R' car marker painted on coping approx. 72.462m from fence. New '6R' car marker painted on coping approx. 48.379m from fence.
Wyong	1 Sydney End	New '3R' car marker painted on coping approx. 76.713m from fence. New '6R' car marker painted on coping approx. 28.553m from fence.
Wyong	1 Country End	New '3R' car marker painted on coping approx. 57.994m from fence. New '6R' car marker painted on coping approx. 14.432m from fence.
Wyong	2 Sydney End	New '3R' car marker painted on coping approx. 68.612m from fence. New '6R' car marker painted on coping approx. 20.452m from fence.
Wyong	2 Country End	New '3R' car marker painted on coping approx. 64.336m from fence. New '6R' car marker painted on coping approx. 40.255m from fence.
Wyong	3 Sydney End	New '3R' car marker painted on coping approx. 65.113m from fence. New '6R' car marker painted on coping approx. 16.954m from fence.
Wyong	3 Country End	New '3R' car marker painted on coping approx. 66.772m from fence. New '6R' car marker painted on coping approx. 42.692m from fence.

VER18092026
Jonathan Durnell

Design Manager, T4T

Mob: 0414 127 445

Email: jdurnell@TransForT.com.au

Brian Pham

Senior Project Engineer, T4T

Mob: 0447 928 821

Email: BPham@TransforT.com.au

James Cho

Construction Manager, T4T

Mob: 0436 467 756

Email: jcho@TransForT.com.au

REDFERN (WELLS STREET) STAGE 2 - RENEWAL OF 642A & 644A POINTS TO "A" UNIT WITH IN-BEARER SPHEROLOCK AND POINT CONDITION MONITORING

Commencing at 0200 hours on **Saturday, 24th October 2026**, and continuing until 0200 hours on Monday, 26th October 2026, the following work will be carried out:

- The existing 642A turnout on the Up Local will be renewed with an in-bearer spherolock arrangement and relocated approximately 2.7m towards Redfern.
- The 642A point controller will be renewed with an 'A' type point controller unit.
- The existing Keyless type Emergency Operations Lock (EOL) for 642 points remains unchanged located adjacent to 642B/C points end.
- The existing 644A turnout on the Down Local will be renewed with an in-bearer spherolock arrangement and relocated approximately 2.8m towards Redfern.
- The 644A point controller will be renewed with an 'A' type point controller unit.
- The existing Keyless type Emergency Operations Lock (EOL) for 644 points remains unchanged located adjacent to 644B/C points end.
- SY439L Co-Acting Signal on the Down Local will be relocated 4.6m towards Redfern.
- SY439L Trainstop will be relocated adjacent to SY439L Co-Acting Signal.

A Drivers Diagram showing the new arrangement appears in this Weekly Notice.

VER 06022026

DIAGRAM VER 06022026

Glen Collins

Commissioning Engineer

Major Works – Sydney Trains

Mobile: 0468 606 411

Email: glen.collins@transport.nsw.gov.au


Joe Trinh

Engineering Manager

JMD Railtech Pty Ltd.,

Mob: 0411 566 162

Email: joe.trinh@jmdr.com

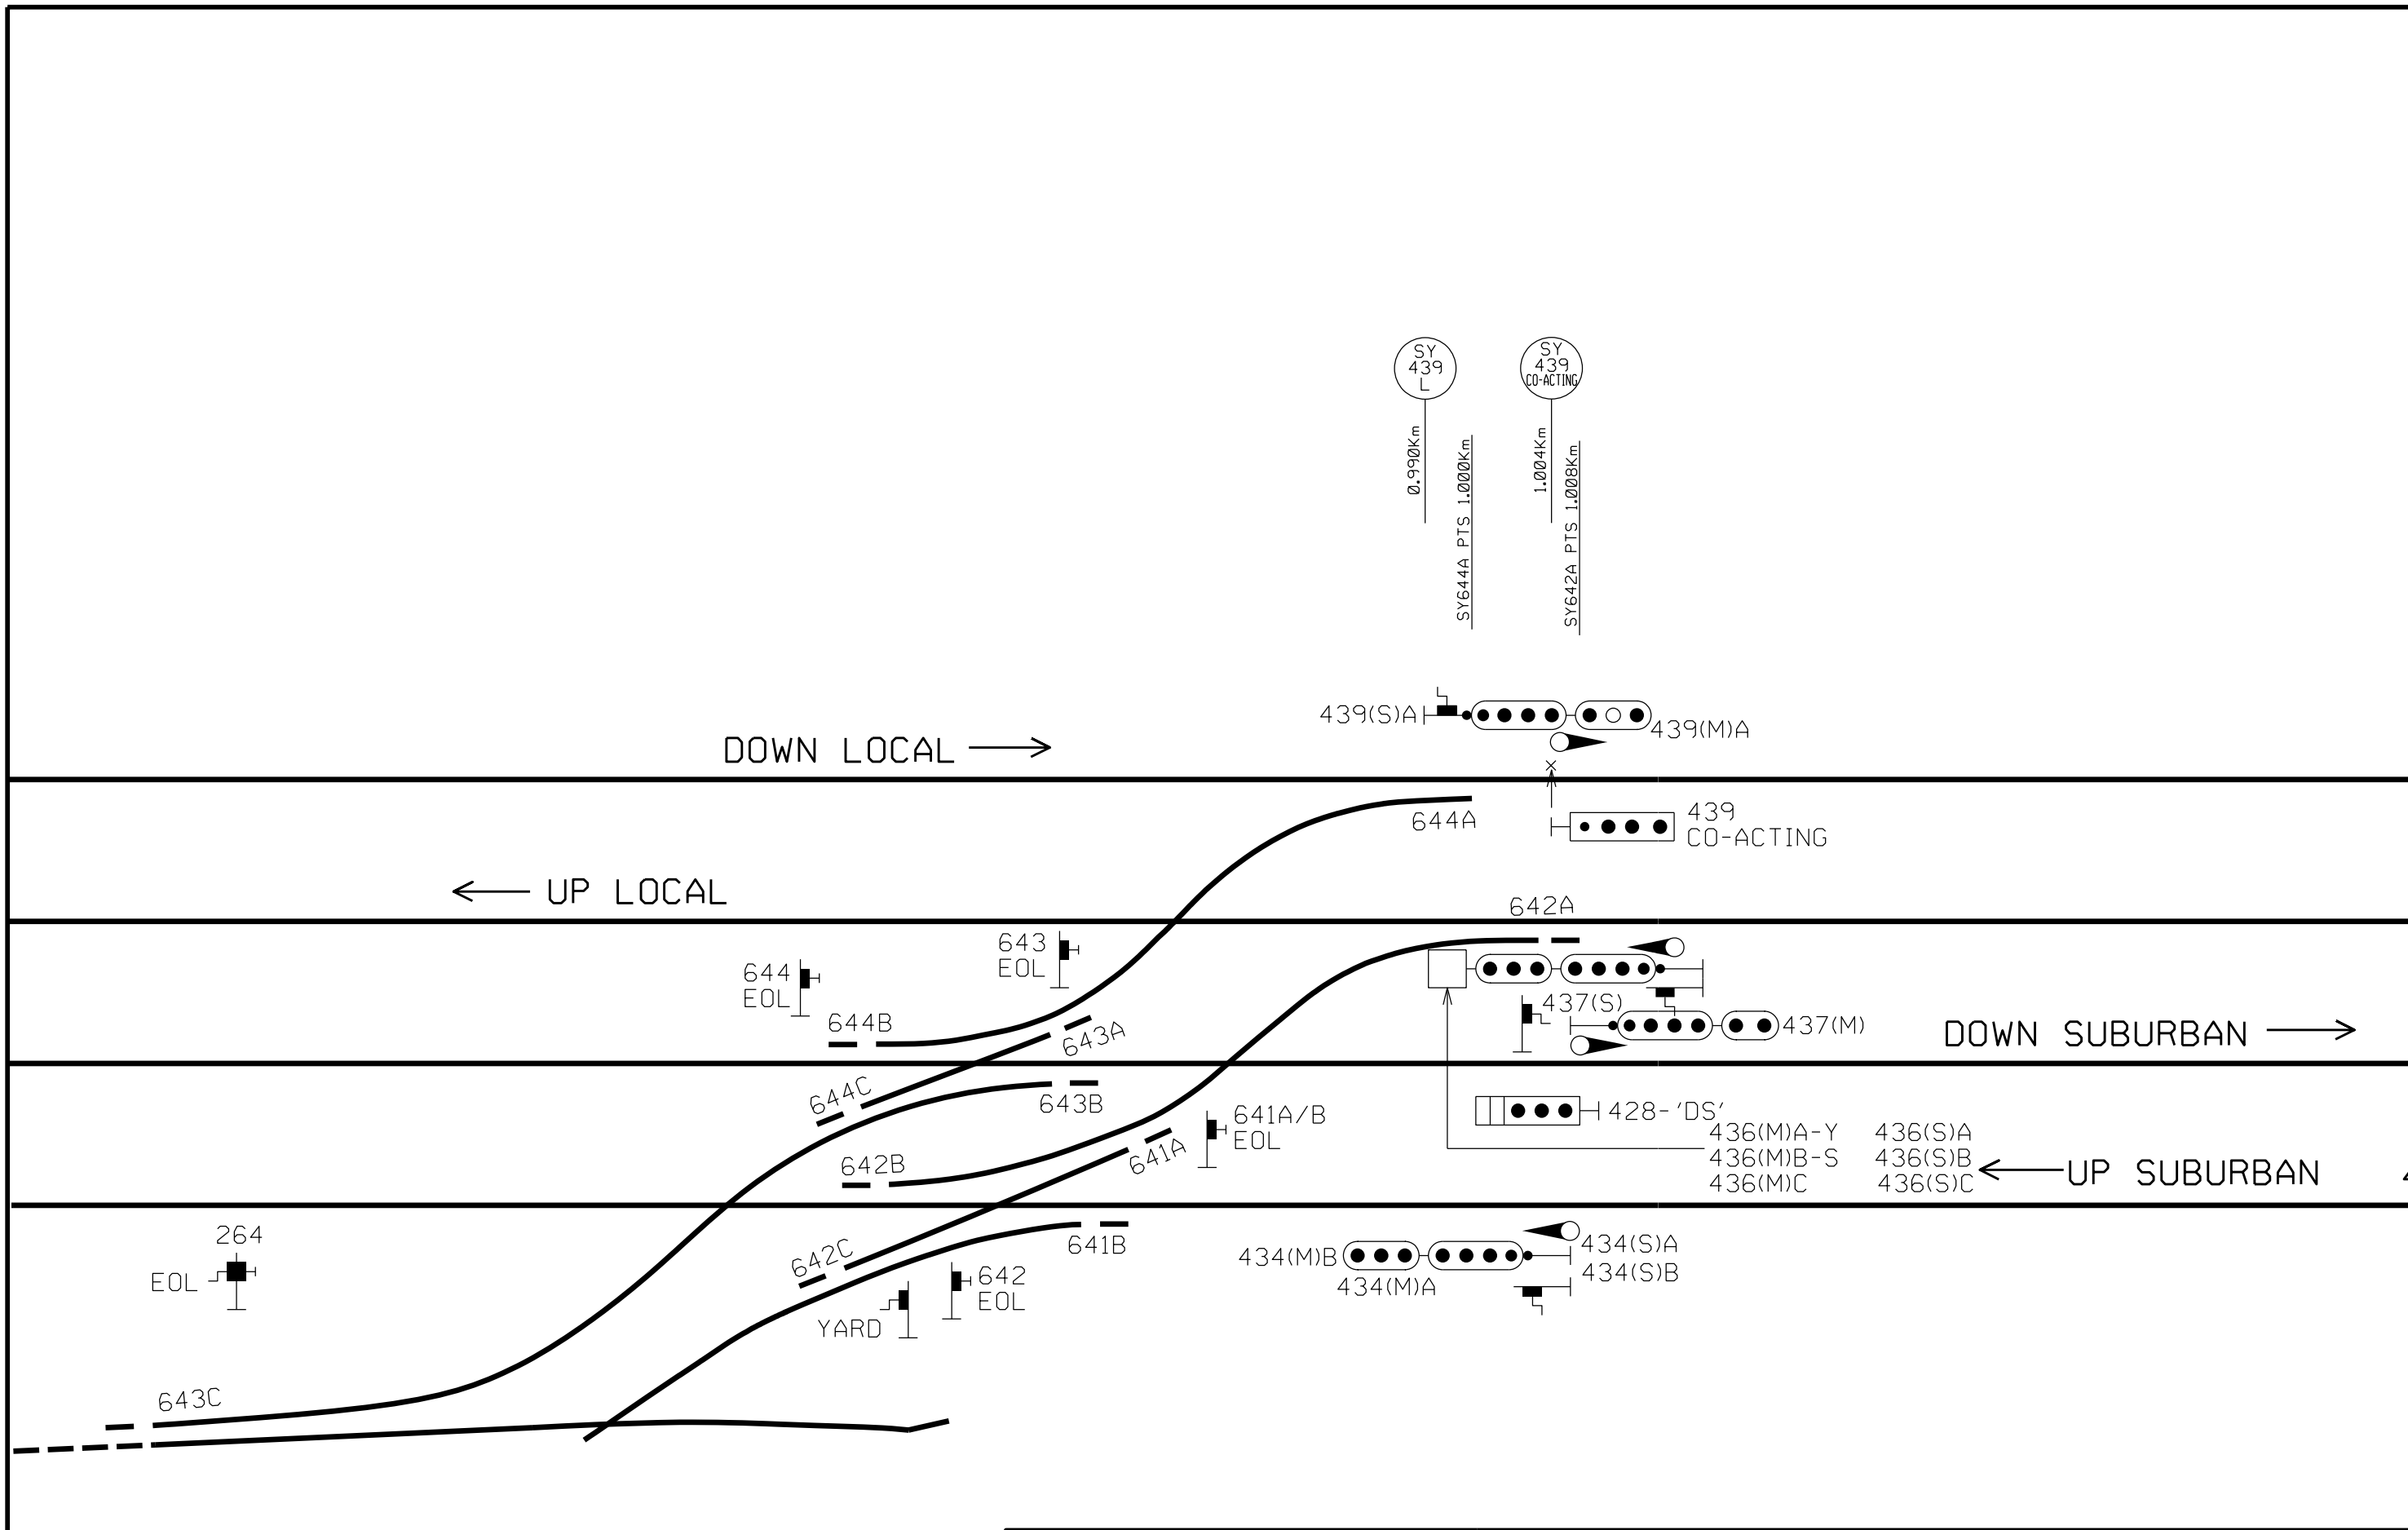

Transport
for NSW

REDFERN
RENEWAL OF 642A & 644A POINTS TO "A" UNIT WITH
IN BEARER SPHEROLOCK AND POINT CONDITION MONITORING
DRIVERS DIAGRAM SHEET 1 OF 1
Produced by JMDR
VER. 06022026

JMDR VERSION DATE: 20/02/2026

REGIONAL RAIL/NEW INTERCITY FLEET INFRASTRUCTURE UPGRADES - SOUTH COAST LINE -STAGE 10B – CORRIMAL (ILLAWARRA) – RELOCATION OF SIGNAL WG503U & SPEED BOARD CHANGE

Commencing at 0200 hours on **Saturday 10 October 2026** and continuing until 0200 hours on Monday 12 October 2026, the following work will be carried out:

Corrimal Signal Alterations

- Signal WG503U on the Up Illawarra Main will be renewed to a new LED signal 42m towards country at approx. 77.110km.
- The signal will retain its existing aspects without change. No change to signal route designations.
- A Drivers Diagram showing the new arrangement appears in this Weekly Notice.

Corrimal speed board change

- The existing 90/100/100 speed board located on a post at approx. 77.859km on the Up Illawarra Main Down Direction, will be replaced with a new 85/100/100 speed board at the same location.

VER 21082026

DRIVERS DIAGRAM (CORRIMAL) VER 18022026

Matthew Ward

Signalling Commissioning Engineer, JMDR

Mob: 0403 689 614

Email: matthews.ward@jmdr.com


Andrew Muscat

Signal Design Engineer, Sigtech Solutions

Mob: 0418998805

Email: andrew.muscat@sigtechsolutions.com.au

CORRIMAL

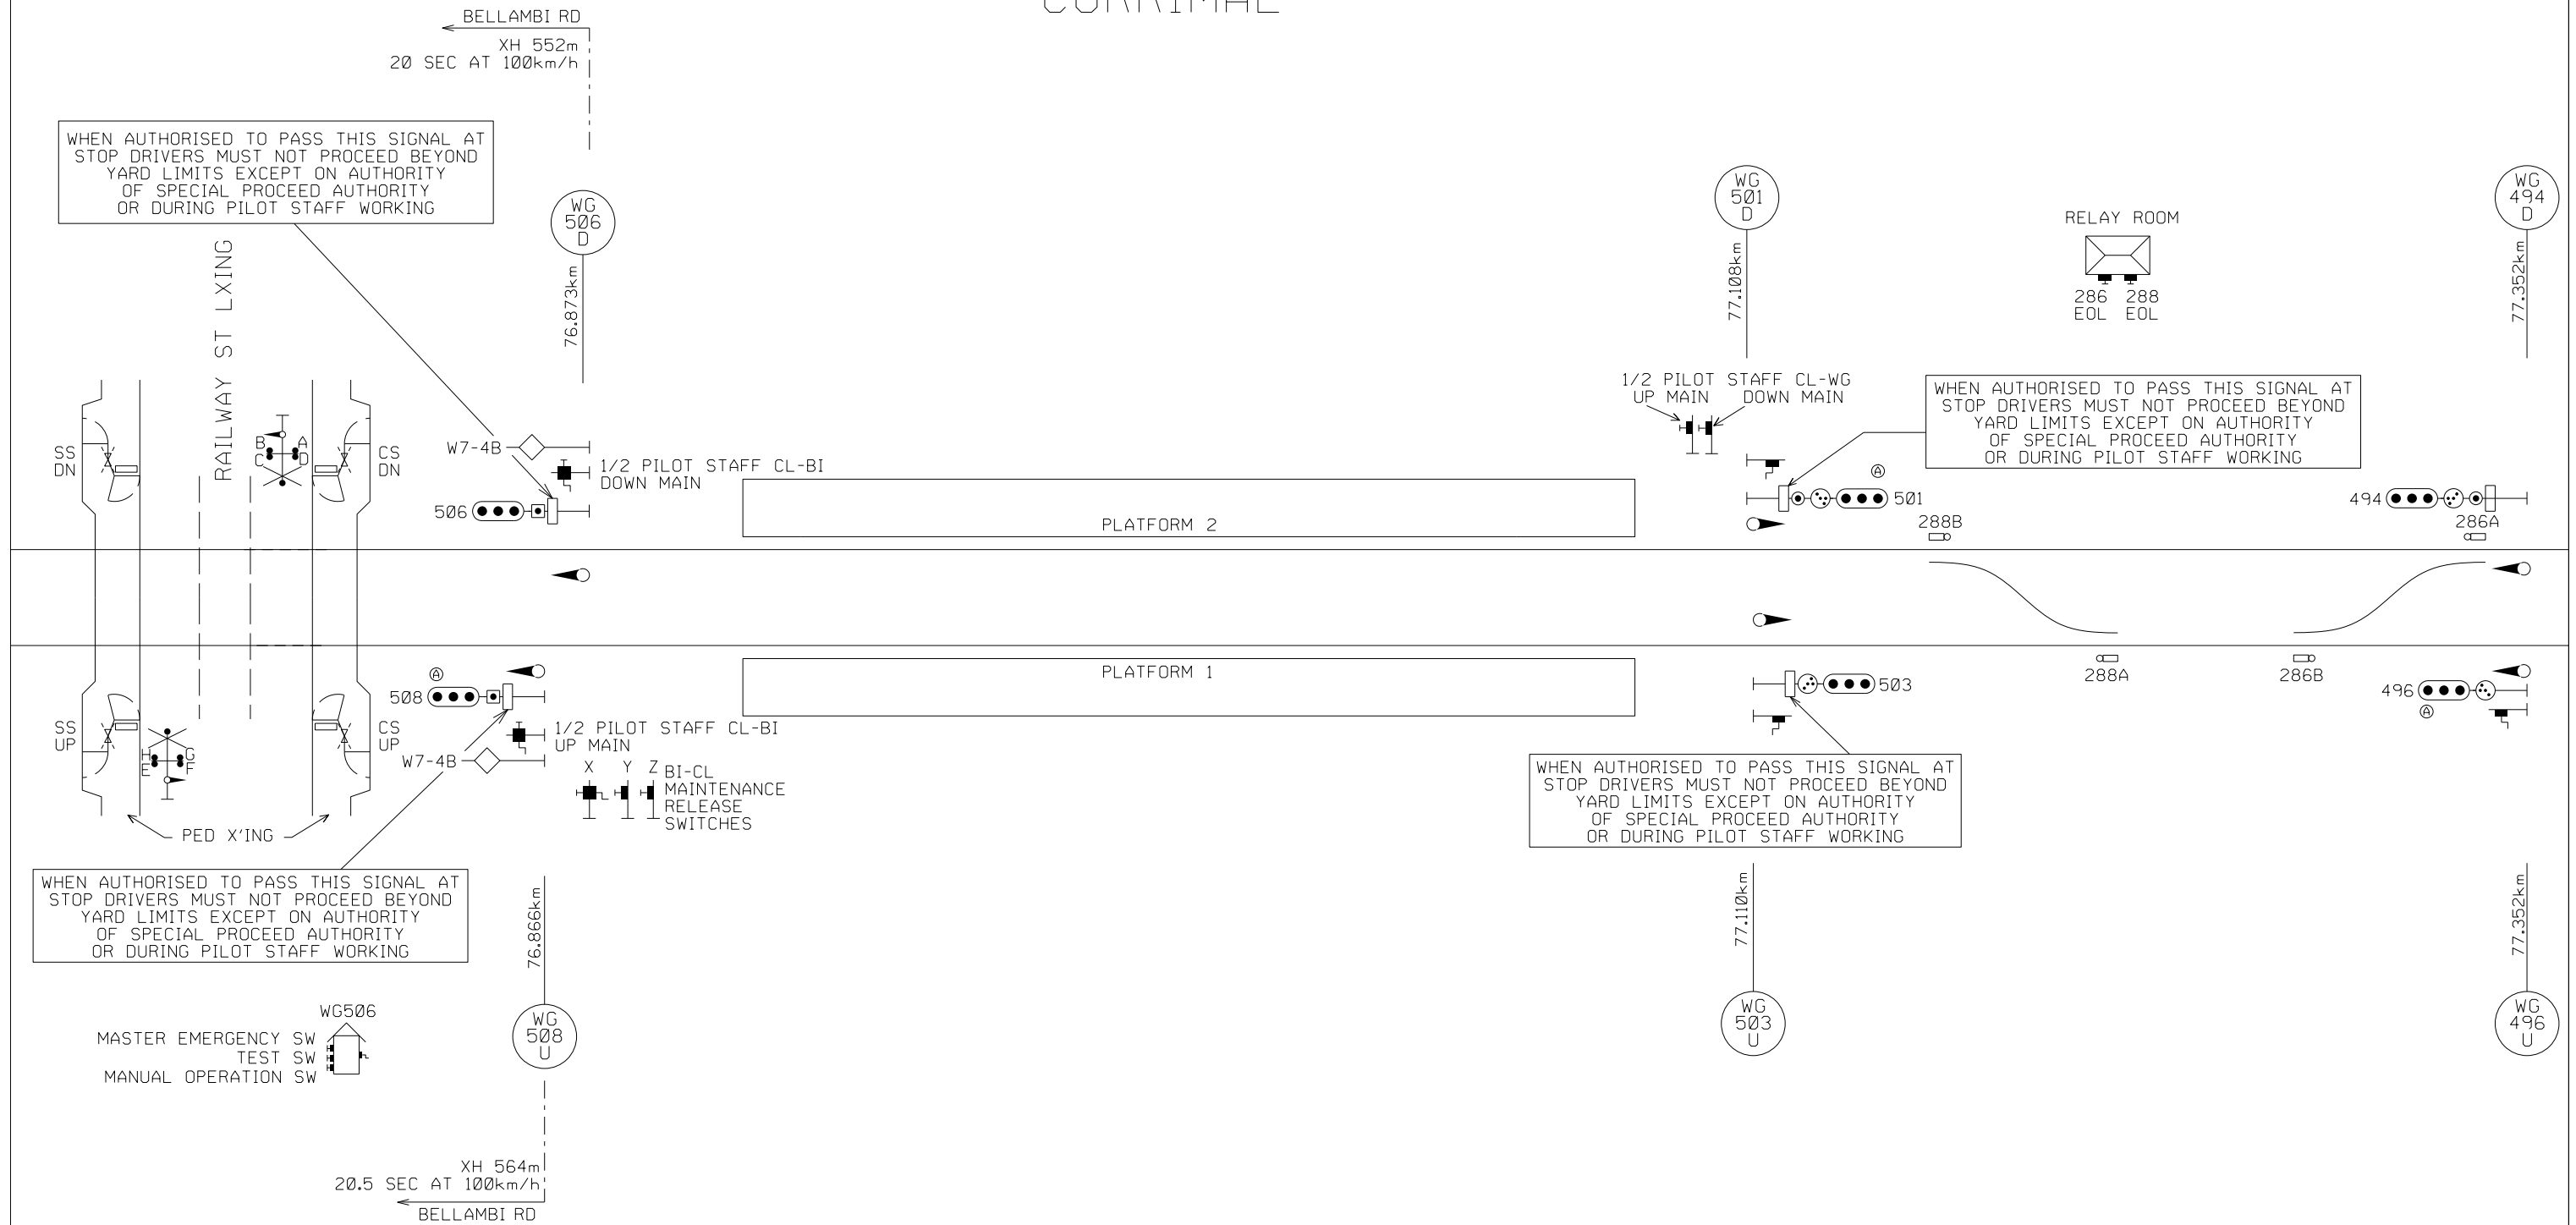

COCKLE CREEK (NORTH) STAGE 1 – REMOVAL OF 110, 111 TURNOUTS & CATCHPOINTS AND 112 CROSSOVER

Commencing at 0200 hours on **Saturday, 3 of October 2026**, and continuing until 0200 hours on Tuesday, 6 of October 2026, the following works will be carried out:

- 104(S)B route will be booked out of use.
- Existing 110 Turnout and Catchpoint will be removed.
- Existing 110 ESML will be removed.
- Existing 111A Catchpoint, which is currently booked out of use, will be removed.
- Existing 111B point machine will be removed.
- Existing 111 Maintenance Isolation switch and 111 EOL will be removed.
- Existing 112A points on Down Main Line, Clipped, XL Locked and Spiked normal and booked out of use, will be removed and straight railed.
- Existing 112B points on Up Main Line, Clipped, XL Locked and Spiked normal and booked out of use, will be removed and straight railed.
- Existing 112 EOL and phone will be removed.
- Sulphide Junction Local control panel will be updated to reflect the new layout.
- Broadmeadow control and indication panels will be updated to reflect the new layout.

VER15092026
DIAGRAM VER15092026

Jarred Neave

Signalling Commissioning Engineer
NRG Signalling Pty Ltd
Mobile: 0422 426 292
Email: jarred@nrgsignalling.com

Raghavendra Chitlur

Design Manager

JMD Railtech Pty Ltd

Mobile: 0470 391 814

Email: raghavendra.chitlur@jmdr.com

REGIONAL RAIL/NEW INTERCITY FLEET INFRASTRUCTURE UPGRADES - REGIONAL RAIL PHASE 01 - BOWENFELS (WEST) – COMMISSIONING OF ATP CHANGES, NEW BEGIN AND END ATP SIGNS

SINCE NOTICE

Since 1800 hours on **Thursday, 17 September 2026**, the following works have been deferred and will be advertised in a new Weekly Notice

- Commissioning of ATP changes on the UP Main & DOWN Main between Bowenfels to the boundary between Sydney Trains and CRN (Regional Linx)
- New "BEGIN ATP" and "END ATP" Signage will be commissioned into use. Refer to Table 1 for details.
- A Drivers Diagram showing the new ATP Signs arrangement appears in this Weekly Notice.

Table 01 New ATP Signs

Location	Line	Direction	Inscription
Bowenfels at 158.569Km	Down Main	Down	END ATP
Bowenfels at 158.568Km	Down Main	Up	BEGIN ATP
Bowenfels at 158.547Km	Up Main	Down	END ATP
Bowenfels at 158.548Km	Up Main	Up	BEGIN ATP

VER22092026

DRIVERS DIAGRAM (BOWENFELS) VER25082026

Adam Toffolo

Signalling Commissioning Engineer, JMDR

Mob: 0416 942 861


Email: adam.toffolo@jmdr.com

Praneeth Challa

Signalling Design Engineer, Sigtech Solutions

Mob: 0470 558 126

Email: praneeth.challa@sigtechsolutions.com.au

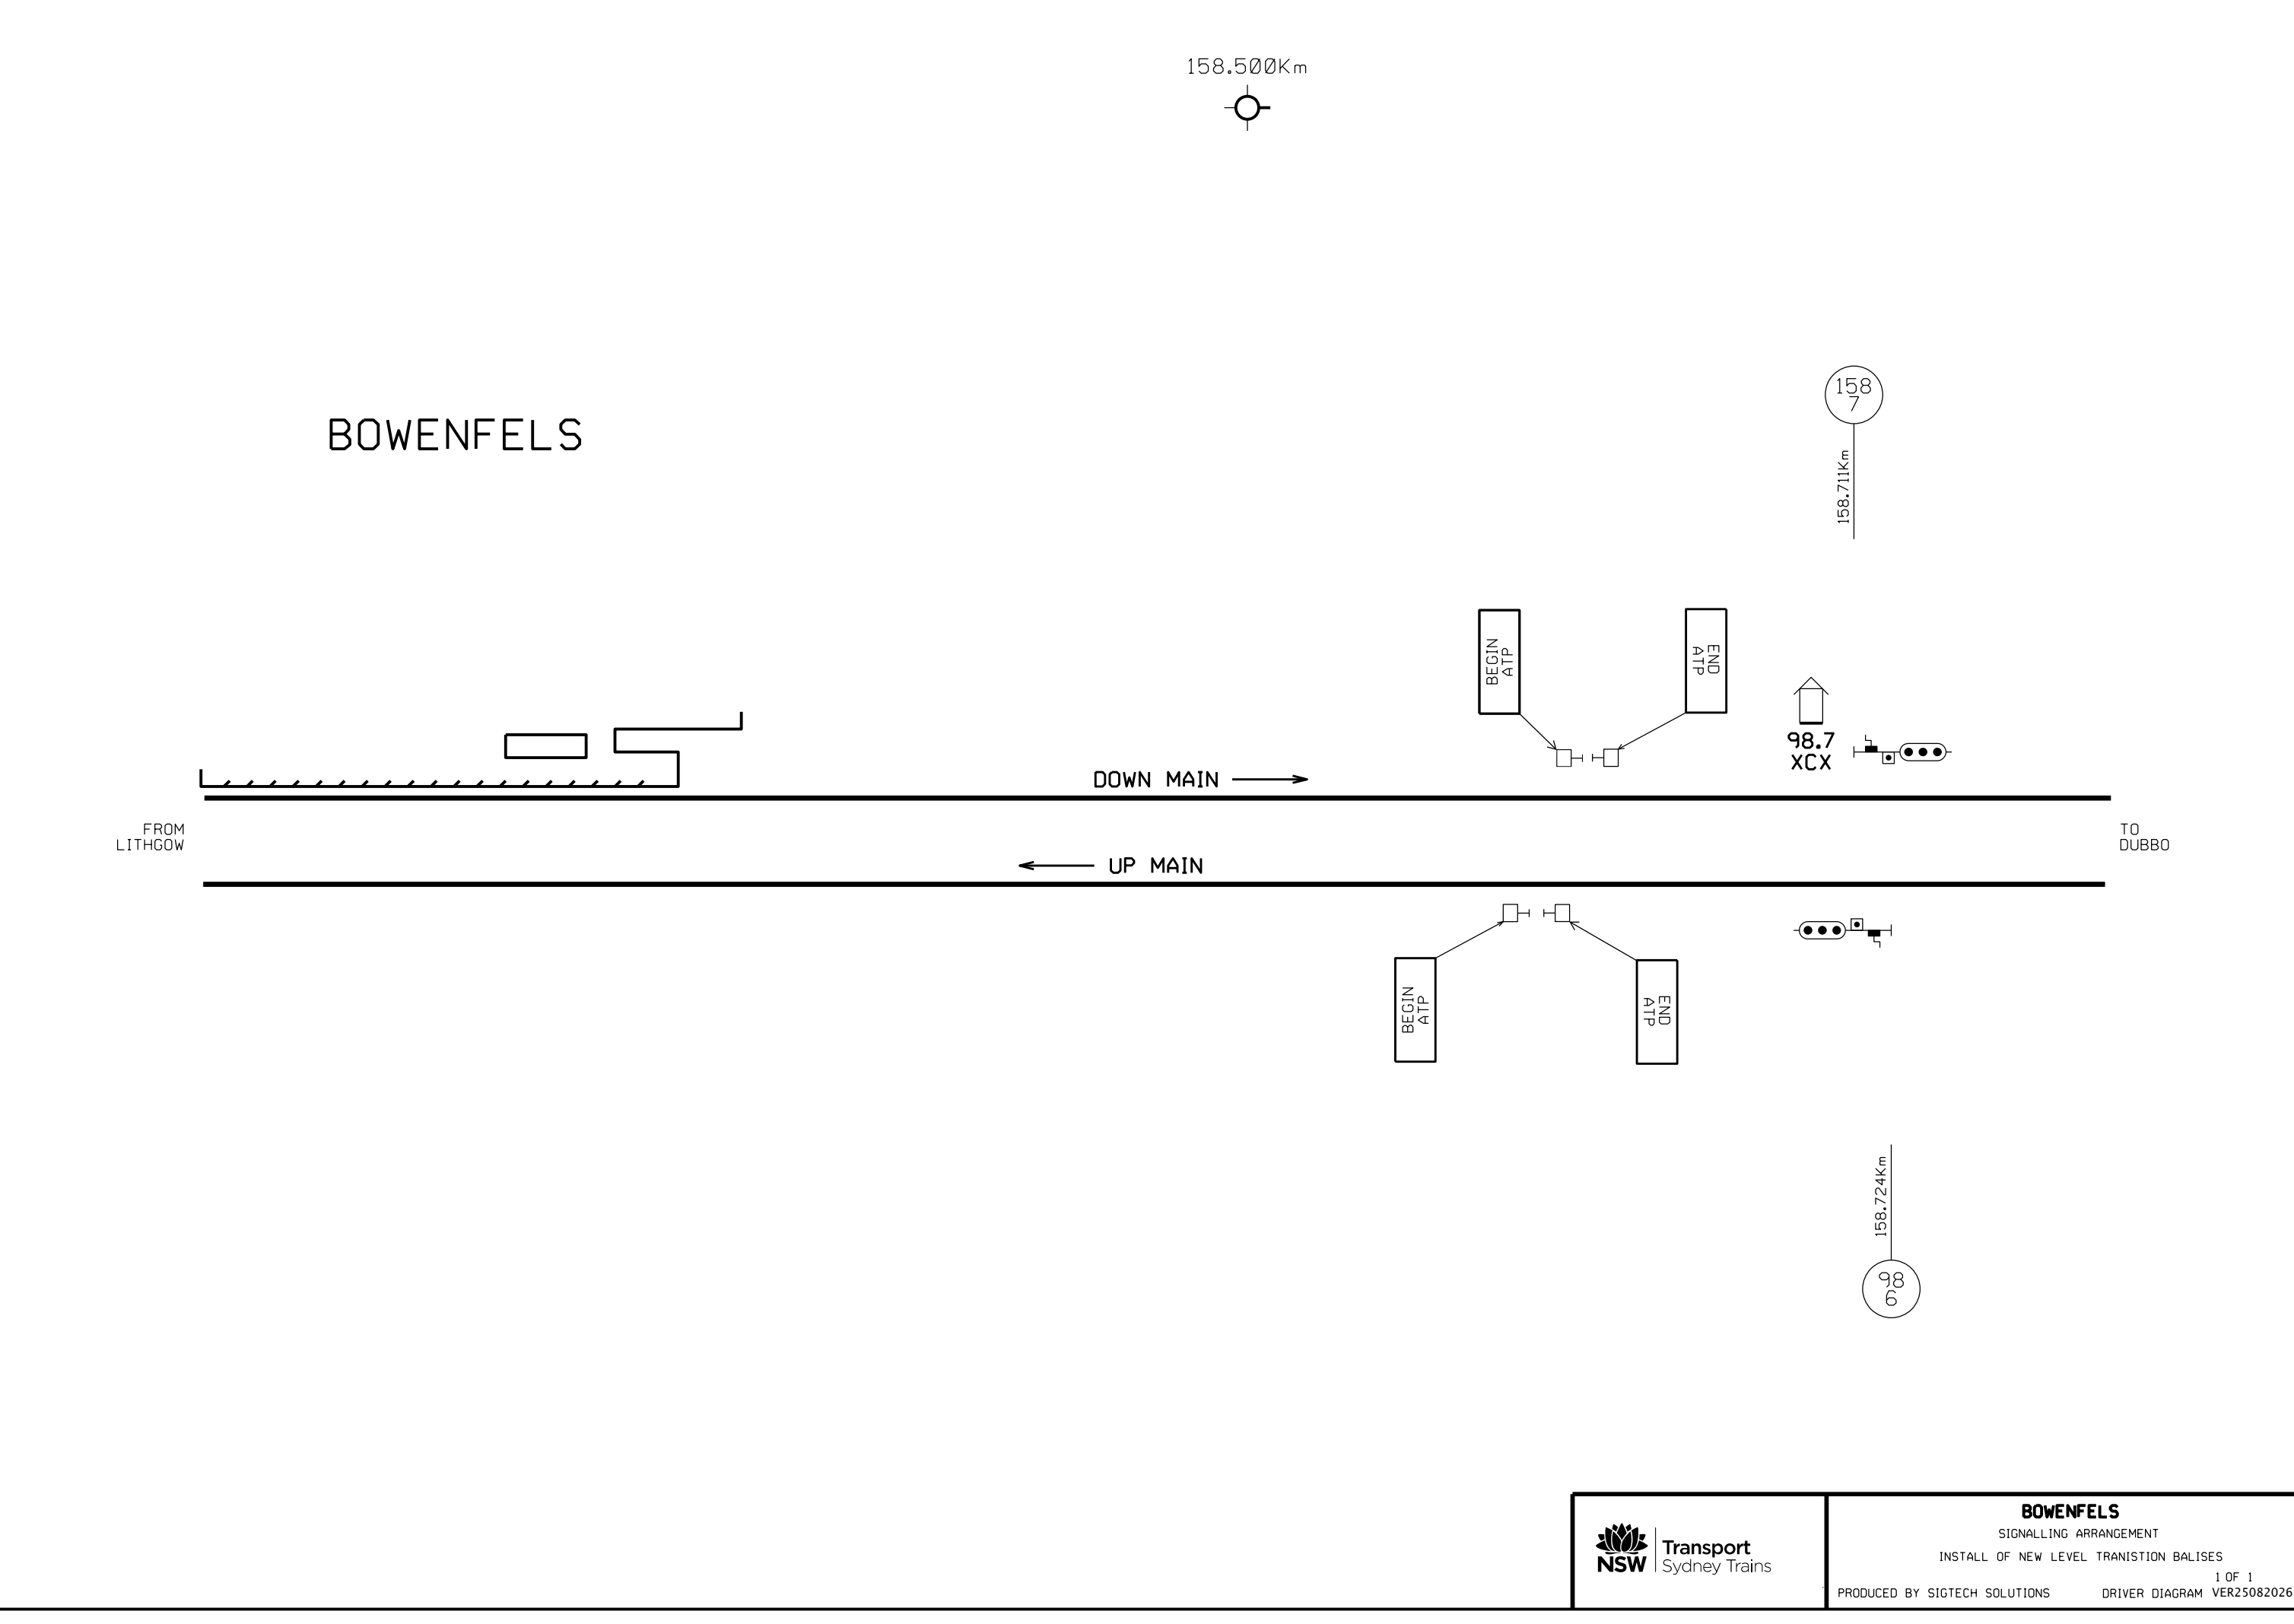

STATUS OF TOM NOTICES

<i>Number</i>	<i>Title</i>	<i>Issued</i>	<i>Effective</i>
010 – 2012	48 Class: Train Operations Manual (TOM)	25/10/12	04/11/12
003 – 2013	48 Class: Wheels	07/02/13	10/02/13
004 – 2016	OMET 262: Failure of Train Management System	14/07/16	24/07/16
004 – 2017	TWP 174 Ice Radio	20/07/17	31/07/17
012 – 2018	OMET 228 Control Circuit Failure	23/08/18	02/09/18
005 – 2018	OMET 242 Reverser handle jams in forward or reverse	18/08/18	28/08/18
006 – 2018	OMET 250 Applying power from the rear	18/08/18	28/08/18
008 – 2018	TWP 154 Responding to incapacitated Driver/Guard	05/07/18	15/07/18
016 – 2018	Network Rules Operational standards update	17/08/18	30/09/18
003 – 2019	OMET 264: Minimum Tractive Effort Requirements	21/02/19	03/03/19
001 – 2019	OMET 266 Operation of Y sets	22/03/19	03/03/19
012 – 2019	TWP 192: Working Trains Out of service	21/02/19	03/03/19
007 – 2019	TWP 136 Defective wheels	06/03/19	24/03/19
008 – 2019	TWP 190 Automatic Train Protection	06/03/19	24/03/19
009 – 2019	TWP 110 Train crew relieved in service & relay driver	06/03/19	24/03/19
004 – 2019	TWP 118 Reporting Faults	11/04/19	28/04/19
004 – 2020	TWP 124 Defective Brakes	20/05/20	08/06/20
005 – 2020	TWP 126 Defective Automatic Brakes	20/05/20	08/06/20
012 – 2020	WAR 202 Bogie Faults	20/05/20	08/06/20
011 – 2020	TWP 162 Train Crew Bell Signals	02/06/20	15/06/20
014 – 2020	TWP 112 Changing ends	20/07/20	03/08/20
017 – 2020	Operating Tangara, OSCAR, Millenium and Waratah with deflated air springs in the city underground	07/12/20	14/12/20
005 – 2022	TWP 160 Driver procedure at stations	21/04/22	08/05/22
023 – 2022	Exception to OMET 254 Topside Preparation Locations	16/08/22	22/08/22
028 – 2022	Testing of Tangara Sets fitted with European Train Control System (ETCS) Level 1 & Level 2 (In cab signalling) equipment at Mortdale Maintenance Centre	08/12/22	16/12/22
027 – 2022	TWP 150: Damaged or Missing Window Glass	27/09/22	10/10/22
014 – 2023	Use of Automatic Train Protection (ATP) equipment on Millennium trains	20/02/23	05/03/23
017 – 2023	TWP 138 Assisting Trains using Emergency Couplers	07/03/23	20/03/23
022 – 2023	WB Radios on Waratah, Oscar, Millenium, Tangara and K sets	05/04/23	23/04/23
023 – 2023	Operation of H-set trains fitted with Automatic Train Protection (ATP) equipment	19/06/23	26/06/23
028 – 2023	TWP 176: Wayside Train Condition Monitoring	07/08/23	21/08/23
026 – 2023	TWP 156: Operating doors	15/09/23	25/09/23
032 – 2023	TWP 100 Responsibilities of Train Crews	19/09/23	30/09/23
031 – 2023	Operation of Tangara trains fitted with ATP with Automatic Train Protection (ATP)	10/10/23	16/10/23
033 – 2023	Waratah (A and B SET) trains fitted with Automatic Train Protect equipment	17/10/23	23/10/23

<i>Number</i>	<i>Title</i>	<i>Issued</i>	<i>Effective</i>
034 - 2023	Testing Tangara trains fitted with ETCS Level 2	02/11/23	03/11/23
001 – 2024	TWP 182 Digital Train Radio	12/02/24	26/02/24
003 – 2024	Transition of NSW TrainLink Intercity Drivers and Guards to Sydney Trains	12/06/24	01/07/24
005 – 2024	Testing of OSCAR train H5 set with ETCS trackside equipment	15/08/24	31/08/24
006 - 2024	TWP 152 Disabled trains	18/11/24	05/12/24
014 - 2025	Testing commissioning of regional train	31/08/25	31/08/25
016 - 2025	Transfer and Testing of OSCAR Train (H5 set) with the Automatic Train Protection (ATP) Trackside System	29/10/25	29/10/25
015 - 2025	OMET 200 Minimum Standards for Electric Trains	30/09/25	13/10/25
013 - 2025	Tangara Nosing Trial	05/11/25	14/11/25
008 - 2025	OMET 208 Train types and locations of isolating cocks	11/11/25	24/11/25
010 - 2025	OMET 220 Wheels slip light indications	11/11/25	24/11/25
013 – 2026	TWP 194 Using the Emergency Button	02/02/26	02/02/26
014 – 2026	Operation of Tangara Train fitted with ATP	23/02/26	23/02/26
016 – 2026	Testing of Tangara Fleet life extension (TFLE) in non revenue service	13/03/26	13/03/26
020 – 2026	Introduction of Tangara Fleet Life Extension (TFLE) trains in revenue service	28/08/26	28/08/26
021 – 2026	Operation ATP on TFLE Tangara Trains	28/08/26	28/08/26

STATUS OF PERMANENT SAFE NOTICES

<i>Number</i>	<i>Title</i>	<i>Issued</i>	<i>Effective</i>
002 - 2026	Use of Signal Key Switches	16/04/26	28/04/26
003 - 2026	New Trackside Signage associated with Digital Systems Train Testing	30/04/26	30/04/26

NRU

Website: www.railsafe.org.au

Email: nru@transport.nsw.gov.au

STATUS OF NETWORK MANUALS AND FORMS

Network Manuals

Network Local Appendices	RailSafe Website	Online documents
Operator Specific Procedures	RailSafe Website	Online documents
Network Rules	RailSafe Website	Online documents
Network Procedures	RailSafe Website	Online documents
Forms	RailSafe Website	Online documents (or order as applicable)

<i>Title</i>	<i>Status Sheet</i>	<i>Date issued</i>
--------------	---------------------	--------------------

<i>Train Working Procedures</i>		
---------------------------------	--	--

TWP 100	TN 032 - 2021	September 2023
TWP 102		May 2012
TWP 108		May 2012
TWP 110	TN 009 - 2019	March 2019
TWP 112	TN 014 - 2020	August 2020
TWP 114		November 2015
TWP 116		May 2012
TWP 118	TN 004 - 2019	April 2019
TWP 120		May 2012
TWP 122		May 2012
TWP 124	TN 004 - 2020	June 2020
TWP 126	TN 005 - 2020	June 2020
TWP 128		May 2012
TWP 130		May 2012
TWP 132		May 2012
TWP 134		May 2012
TWP 136	TN 007 - 2019	March 2019
TWP 138	TN 017 - 2023	March 2023
TWP 142		May 2012
TWP 144		May 2012
TWP 146		May 2012
TWP 148		May 2012
TWP 150	TN 027 - 2022	October 2022
TWP 152	TN 006 - 2024	December 2024
TWP 154	TN 008 - 2018	July 2018
TWP 156	TN 026 - 2023	September 2023
TWP 160	TN 005 - 2022	May 2022
TWP 162	TN 011- 2020	June 2020
TWP 164		May 2012
TWP 166		May 2012
TWP 168		May 2012
TWP 170		May 2012
TWP 172		May 2012
TWP 174	TN 004 - 2017	July 2017
TWP 176	TN 028 - 2023	August 2023
TWP 182	TN 001 - 2024	February 2024
TWP 188		November 2015
TWP 190	TN 008 - 2019	March 2019
TWP 192	TN 012 - 2019	March 2019

DISTRIBUTION OFFICERS**Sydney Trains****Safety and Environment****Maria Economou**

Safety Support

 2 4502 2 1840 Maria.Economou@transport.nsw.gov.au**Train Crew Operations****Manager Day of Operations** 8577 7029

TCOManagerDayofOperations@transport.nsw.gov.au

Train Crewing**Kelly Adams**

Operating Standards Officer

 0431035642 Kelly.Adams@transport.nsw.gov.au**Service Delivery Response****Megan Parker**

Service Delivery Response

 0491226502 megan.parker@transport.nsw.gov.au**Maintenance****Fleet Maintenance****Hoshedar Movdawalla**

Fleet Maintenance Sydney Trains

 2 0532 2 1274 HOSHEDAR.MOVDAWALLA@transport.nsw.gov.au**Network Maintenance****Zaneta Janevski**

Engineering & Maintenance

 87570199 zaneta.janevski@transport.nsw.gov.au**Eric Sague**

Engineering & Maintenance

Materials Inspector

 0447117499 eric.surge@transport.nsw.gov.au**Shaun Smith**

Maintenance Planner - North

 0401710427 shaun.smith@transport.nsw.gov.au**Jake Hamilton**

Track Access Coordinator – North

 0475771021 jake.hamilton@transport.nsw.gov.au**Bradley Stewart**

Territory Planning Manager - Central Coast/Hamilton

 0476 833 911 bradley.stewart@transport.nsw.gov.au**Ennio Soster**

SCE

Project Delivery Electrical

 25236 25917 ENNIO.SOSTER@transport.nsw.gov.au**Daljit Kaur**

Infrastructure Maintenance — Facilities

 2 5922 2 5950 Daljit.Kaur@transport.nsw.gov.au**Adrian Aquilina**

Team leader - Strathfield Mains

 97526610 adrian.aquilina@transport.nsw.gov.au

Christina Morgan

Administration Support

ICON

 9379 6051 Christina.Morgan@transport.nsw.gov.au**Lorinda Melvin**

Administration Support

 0439510480 lorinda.melvin@transport.nsw.gov.au**Major Works****Greg Page**

Infrastructure Track

 25375 gregory.page@transport.nsw.gov.au**Michael Warner**

Signals and Electricity

 9848 9333 michael.warner@transport.nsw.gov.au**Engineering & Maintenance****Murari Singh**

Performance Analyst

 0466335059 Murari.Singh@transport.nsw.gov.au**Engineering & System Integrity****Yass Zahab**

Geotechnical Services

 2 7589  2 7786 Yassine.El-Zahab@transport.nsw.gov.au**Richard Agostino**

C and CS

 2 0875  9 2137 Richard.Agostino@transport.nsw.gov.au**Capability & Learning****Samantha Sheriff**

Operations Trainer

 0415822921

Samantha.Sheriff2@transport.nsw.gov.au

Peter Nilon

Survey Group

 9848 9904 peter.nilon@transport.nsw.gov.au**Sonya Khatchigian**

Administration Support – InterCity Sydney Trains

 0438446821 Sonya.Khatchigian@transport.nsw.gov.au**Asel Lupingna**Learning Program & Support Coordinator
People & Culture 0403754214 asel.lupinga@transport.nsw.gov.au**Kyla Ahmann**

Trainee Coordinator

IET, Capability & Learning Enablement

 kyla.ahmann@transport.nsw.gov.au**NSW Trainlink****Brett Wunderlich**Operational Readiness & Standards
Manager 0427458174 Brett.Wunderlich@transport.nsw.gov.au**Robert Blanch**

Area Manager North Service Delivery

 0419498494 ROBERT.BLANCH@transport.nsw.gov.au**Dwayne Purcell**

Area Manager South Service Delivery

 0428670850

DWAYNE.PURCELL@transport.nsw.gov.au

Matthew Thompson

Area Manager Central

 0409106963

Matthew.thompson@transport.nsw.gov.au

NOTES

NOTES

NOTES

NOTICE TO SUBSCRIBERS

The Weekly Notice is issued every Thursday and takes effect on the following Monday.

Those who require the Weekly Notice must ensure that they receive it and are aware of the changes that affect their work duties and responsibilities.

Director Network Standards, Systems & Quality**Sydney Trains**

Level 4, 36-46 George Street

Burwood NSW 2134

Thursday, 24 September 2026