

ASB Worksite Protection for Dunmore to Bombo Routine Network Maintenance Activities

WORK DESCRIPTION	Routine Network Maintenance
WPP NUMBER	SC63C 10118
SCOPE	<p>This SWI is applicable for the worksite protection arrangements using ASB for Routine Network Maintenance Activities performed by South Coast Maintenance Team</p> <p>Work activities include:</p> <ul style="list-style-type: none"> • Points Maintenance • Train Stop Maintenance • Track Circuit Testing • Turnout Inspections • KK Testing • Track Patrol • OHW Inspections • Structures Examinations
AUTHORISATIONS:	<p>Protection Officer: Protection Officer Level 1 or higher</p> <p>Lookout: Handsignaller Level 1 or higher, Protection Officer Level 1 or higher</p>
SAFETY CONTROLS: Absolute Signal Blocking (ASB) arrangements:	<p>ASB established to exclude rail traffic on the Main Line and Loop Line at Dunmore, Main Line and Loop Line at Bombo and the South Coast Branch Line between Dunmore and Bombo</p> <p>For reference only:</p> <p>The assessed ASB protection is:</p> <ul style="list-style-type: none"> • 43.23 Signal at STOP with blocking facilities applied on City side of the Worksite. • 43.21 Signal at STOP with blocking facilities applied on City side of the Worksite. • 43.27 Signal at STOP with blocking facilities applied on City side of the Worksite. • 43.25 Signal at STOP with blocking facilities applied on City side of the Worksite. • 44.7 Signal at STOP with blocking facilities applied on the Country side of the Worksite • 44.28 Signal at STOP with blocking facilities applied on the Country side of the Worksite. • 44.26 Signal at STOP with blocking facilities applied on the Country side of the Worksite. • 44.10 Signal at STOP with blocking facilities applied on the Country side of the Worksite. • 44.8 Signal at STOP with blocking facilities applied on the Country side of the Worksite. • 44.6 Signal at STOP with blocking facilities applied on the Country side of the Worksite. • 53 Points at Shellharbour Junction secured in Normal Position • 50 Points at Bombo secured in the Normal position
PRESTART REQUIREMENTS:	<p>Protection Officer assessment checklist must be completed before instructions in this SWI are followed. Tools and equipment required:</p> <ul style="list-style-type: none"> • Protection Officer requires a phone to contact the Signaller
FURTHER INFORMATION:	<p>NWT 300 Planning work in the Rail Corridor NWT 308 Absolute Signal Blocking NPR 703 Using Absolute Signal Blocking NGE 200 Walking in the Danger Zone NLA 418 Wollongong – Bomaderry (Nowra)</p>

Protection Officer assessment checklist



Protection Officer's name:	Yes (Tick if Yes)	
This document has not expired 12 months beyond the issue date.		
On-site safety assessment has been completed and additional hazards and controls recorded on the pre-work briefing (Page 3).		
SWI details and protection arrangements have been reviewed and validated for the assessed worksite location.		
Corridor Safety Number	Protection Officer Signature	Date

**Warning:**

If an above item does not apply, the Protection Officer must not use this Safe Work Instruction. A new worksite protection plan must be completed in accordance with NRF 014 Worksite Protection Pre-work briefing and NRF 015 Worksite Protection Plan.

Worksite Protection Pre-work Briefing

Briefing date: / /

Protection Officer Details

name	signature	contact no.
------	-----------	-------------

Work location: **Dunmore to Bombo**Scope of work: **Routine Network Maintenance Activities**Worksite protection: **ASB** Refer to Worksite Protection Plan for details

Hazards (e.g. Site-specific hazards identified, including physical environment, human errors, plant and equipment)	Controls (to be implemented to eliminate or reduce the risk to the lowest practicable level)	Person responsible for Control
Approaching rail traffic	ASB implemented. Workers to remain within worksite limits Workers are to stop and move to a safe place immediately on being warned by the Protection Officer	Protection Officer
Adjacent live lines	Designated work and walk areas as instructed by the Protection Officer. Workers must remain within the ASB nominated worksite location limits whilst work is being performed.	Protection Officer
Access to / Egress from worksite	Protection Officer will assess and instruct when it is safe for workers to use NGE 200 Walking in the Danger Zone to move to and from the worksite or safe place.	All
Mobile phone distraction	Mobile phone usage is not allowed in the Danger Zone. Mobile phones may be used only in a safe place after informing the Protection Officer.	All

A final site inspection has been conducted immediately before commencing work, and any new hazards and controls have been included.



Workplace Supervisor Details

name	signature	contact No
------	-----------	------------

Yes the Workplace Supervisor acknowledges that the Protection Officer will arrange worksite protection as required.

Participant Acknowledgment

NOTE: Recipients of the briefing are to question the Briefer if they don't understand any part of this briefing.

All workers listed below acknowledge that they:

1. hold the applicable and current Rail Safety Worker Authorisation
2. have been briefed on the identified hazards and controls
3. have been briefed on the risks from adjacent lines and/or worksites
4. have been briefed on the planned worksite protection
5. understand the limits of the worksite
6. have been briefed on the contents of the Worksite Protection Plan
7. have been shown the worksite protection diagram or map

Worksite Protection Plan – Absolute Signal Blocking

1. ASB Request – Protection Officer Details

name	signature	contact no.
RSW or RIW no.	designation	Planned Duration

Type of work:

2. Worksite Location

On the	Main Line and Loop Line at Shellharbour Junction, South Coast Branch Line and Main Line and Loop Line at Bombo	from	43.27 and 43.25 signals at Dunmore	to	44.28 and 44.26 Signals at Bombo
--------	--	------	------------------------------------	----	----------------------------------

3. Protection to be used

Signal(s) at STOP with blocking facilities applied

Protection is required from other Signallers at

Location / panel

Location / panel

4. Assurances

All points of entry into the affected portion of track are protected and blocking facilities applied

The last rail traffic to pass the protection was

rail traffic ID

The last known location of rail traffic is

location

Confirm that there is no rail traffic between the protection and the worksite

5. Authorisation

Authorised by Signaller

name	South Coast Panel	hr	/
------	-------------------	----	---

Protection Number

Notes

6. Temporarily Suspending ASB

Provide the name and worksite location Workers and equipment are clear of the Danger Zone Provide protection number	<input type="checkbox"/>	Provide the name and worksite location Workers and equipment are clear of the Danger Zone Provide protection number	<input type="checkbox"/>	Provide the name and worksite location Workers and equipment are clear of the Danger Zone Provide protection number	<input type="checkbox"/>
ASB suspended at	hr	ASB suspended at	hr	ASB suspended at	hr

7. Re-establish ASB assurances

The worksite location is identical All points of entry into the affected portion of track are protected and blocking facilities applied	<input type="checkbox"/>	The worksite location is identical All points of entry into the affected portion of track are protected and blocking facilities applied	<input type="checkbox"/>	The worksite location is identical All points of entry into the affected portion of track are protected and blocking facilities applied	<input type="checkbox"/>
The last rail traffic to pass the protection was	rail traffic ID	The last rail traffic to pass the protection was	rail traffic ID	The last rail traffic to pass the protection was	rail traffic ID
The last known location of rail traffic is	location	The last known location of rail traffic is	location	The last known location of rail traffic is	location
There is no approaching rail traffic between the protection and the worksite	<input type="checkbox"/>	There is no approaching rail traffic between the protection and the worksite	<input type="checkbox"/>	There is no approaching rail traffic between the protection and the worksite	<input type="checkbox"/>
ASB re-established at	hr	ASB re-established at	hr	ASB re-established at	hr
Protection No		Protection No		Protection No	

8. Ending

Provide name and worksite location	<input type="checkbox"/>	Workers and equipment clear of the Danger Zone	<input type="checkbox"/>	Provide protection number	<input type="checkbox"/>	Ended at	hr
------------------------------------	--------------------------	--	--------------------------	---------------------------	--------------------------	----------	----



6. Temporarily Suspending ASB

Provide the name and worksite location	<input type="checkbox"/>	Provide the name and worksite location	<input type="checkbox"/>	Provide the name and worksite location	<input type="checkbox"/>
Workers and equipment are clear of the Danger Zone	<input type="checkbox"/>	Workers and equipment are clear of the Danger Zone	<input type="checkbox"/>	Workers and equipment are clear of the Danger Zone	<input type="checkbox"/>
Provide protection number	<input type="checkbox"/>	Provide protection number	<input type="checkbox"/>	Provide protection number	<input type="checkbox"/>
ASB suspended at	hr	ASB suspended at	hr	ASB suspended at	hr

7. Re-establish ASB assurances

The worksite location is identical	<input type="checkbox"/>	The worksite location is identical	<input type="checkbox"/>	The worksite location is identical	<input type="checkbox"/>
All points of entry into the affected portion of track are protected and blocking facilities applied	<input type="checkbox"/>	All points of entry into the affected portion of track are protected and blocking facilities applied	<input type="checkbox"/>	All points of entry into the affected portion of track are protected and blocking facilities applied	<input type="checkbox"/>
The last rail traffic to pass the protection was	rail traffic ID	The last rail traffic to pass the protection was	rail traffic ID	The last rail traffic to pass the protection was	rail traffic ID
The last known location of rail traffic is	Location	The last known location of rail traffic is	location	The last known location of rail traffic is	location
There is no approaching rail traffic between the protection and the worksite	<input type="checkbox"/>	There is no approaching rail traffic between the protection and the worksite	<input type="checkbox"/>	There is no approaching rail traffic between the protection and the worksite	<input type="checkbox"/>
ASB re-established at	hr	ASB re-established at	hr	ASB re-established at	hr
Protection No		Protection No		Protection No	

Notes

6. Temporarily Suspending ASB

Provide the name and worksite location	<input type="checkbox"/>	Provide the name and worksite location	<input type="checkbox"/>	Provide the name and worksite location	<input type="checkbox"/>
Workers and equipment are clear of the Danger Zone	<input type="checkbox"/>	Workers and equipment are clear of the Danger Zone	<input type="checkbox"/>	Workers and equipment are clear of the Danger Zone	<input type="checkbox"/>
Provide protection number	<input type="checkbox"/>	Provide protection number	<input type="checkbox"/>	Provide protection number	<input type="checkbox"/>
ASB suspended at	hr	ASB suspended at	hr	ASB suspended at	hr


7. Re-establish ASB assurances


The worksite location is identical	<input type="checkbox"/>	The worksite location is identical	<input type="checkbox"/>	The worksite location is identical	<input type="checkbox"/>
All points of entry into the affected portion of track are protected and blocking facilities applied	<input type="checkbox"/>	All points of entry into the affected portion of track are protected and blocking facilities applied	<input type="checkbox"/>	All points of entry into the affected portion of track are protected and blocking facilities applied	<input type="checkbox"/>
The last rail traffic to pass the protection was	rail traffic ID	The last rail traffic to pass the protection was	rail traffic ID	The last rail traffic to pass the protection was	rail traffic ID
The last known location of rail traffic is	location	The last known location of rail traffic is	location	The last known location of rail traffic is	location
There is no approaching rail traffic between the protection and the worksite	<input type="checkbox"/>	There is no approaching rail traffic between the protection and the worksite	<input type="checkbox"/>	There is no approaching rail traffic between the protection and the worksite	<input type="checkbox"/>
ASB re-established at	Hr	ASB re-established at	hr	ASB re-established at	hr
Protection No		Protection No		Protection No	




INSTRUCTIONS:	<ol style="list-style-type: none">1. Workers enter the rail corridor via 100 110.760 d Access Gate2. Protection Officer briefs workers about the worksite protection arrangements.3. Protection Officer contacts the Signaller at South Coast Panel to request ASB.4. After ASB has been authorised, start work within the limits of the nominated worksite location.5. After work is complete, workers move to a safe place.6. Protection Officer contacts the Signaller at South Coast Panel to end ASB.7. All workers egress the rail corridor via 100 117.683 U Access Gate
ADDITIONAL DETAILS	<p>Suspending ASB</p> <p>If the ASB is required to be suspended, the Protection Officer must make sure all workers and equipment are clear of the Danger Zone and are in a safe place before suspending the ASB.</p>
ACCESS GATE:	 <p>Image 1: Access gate 100 110.760 D at the end of Dunmore RD. (Old level crossing)</p>  <p>Image 2: Access gate 100 117.683 U off Princes Highway (Commuter carpark)</p>


Diagram

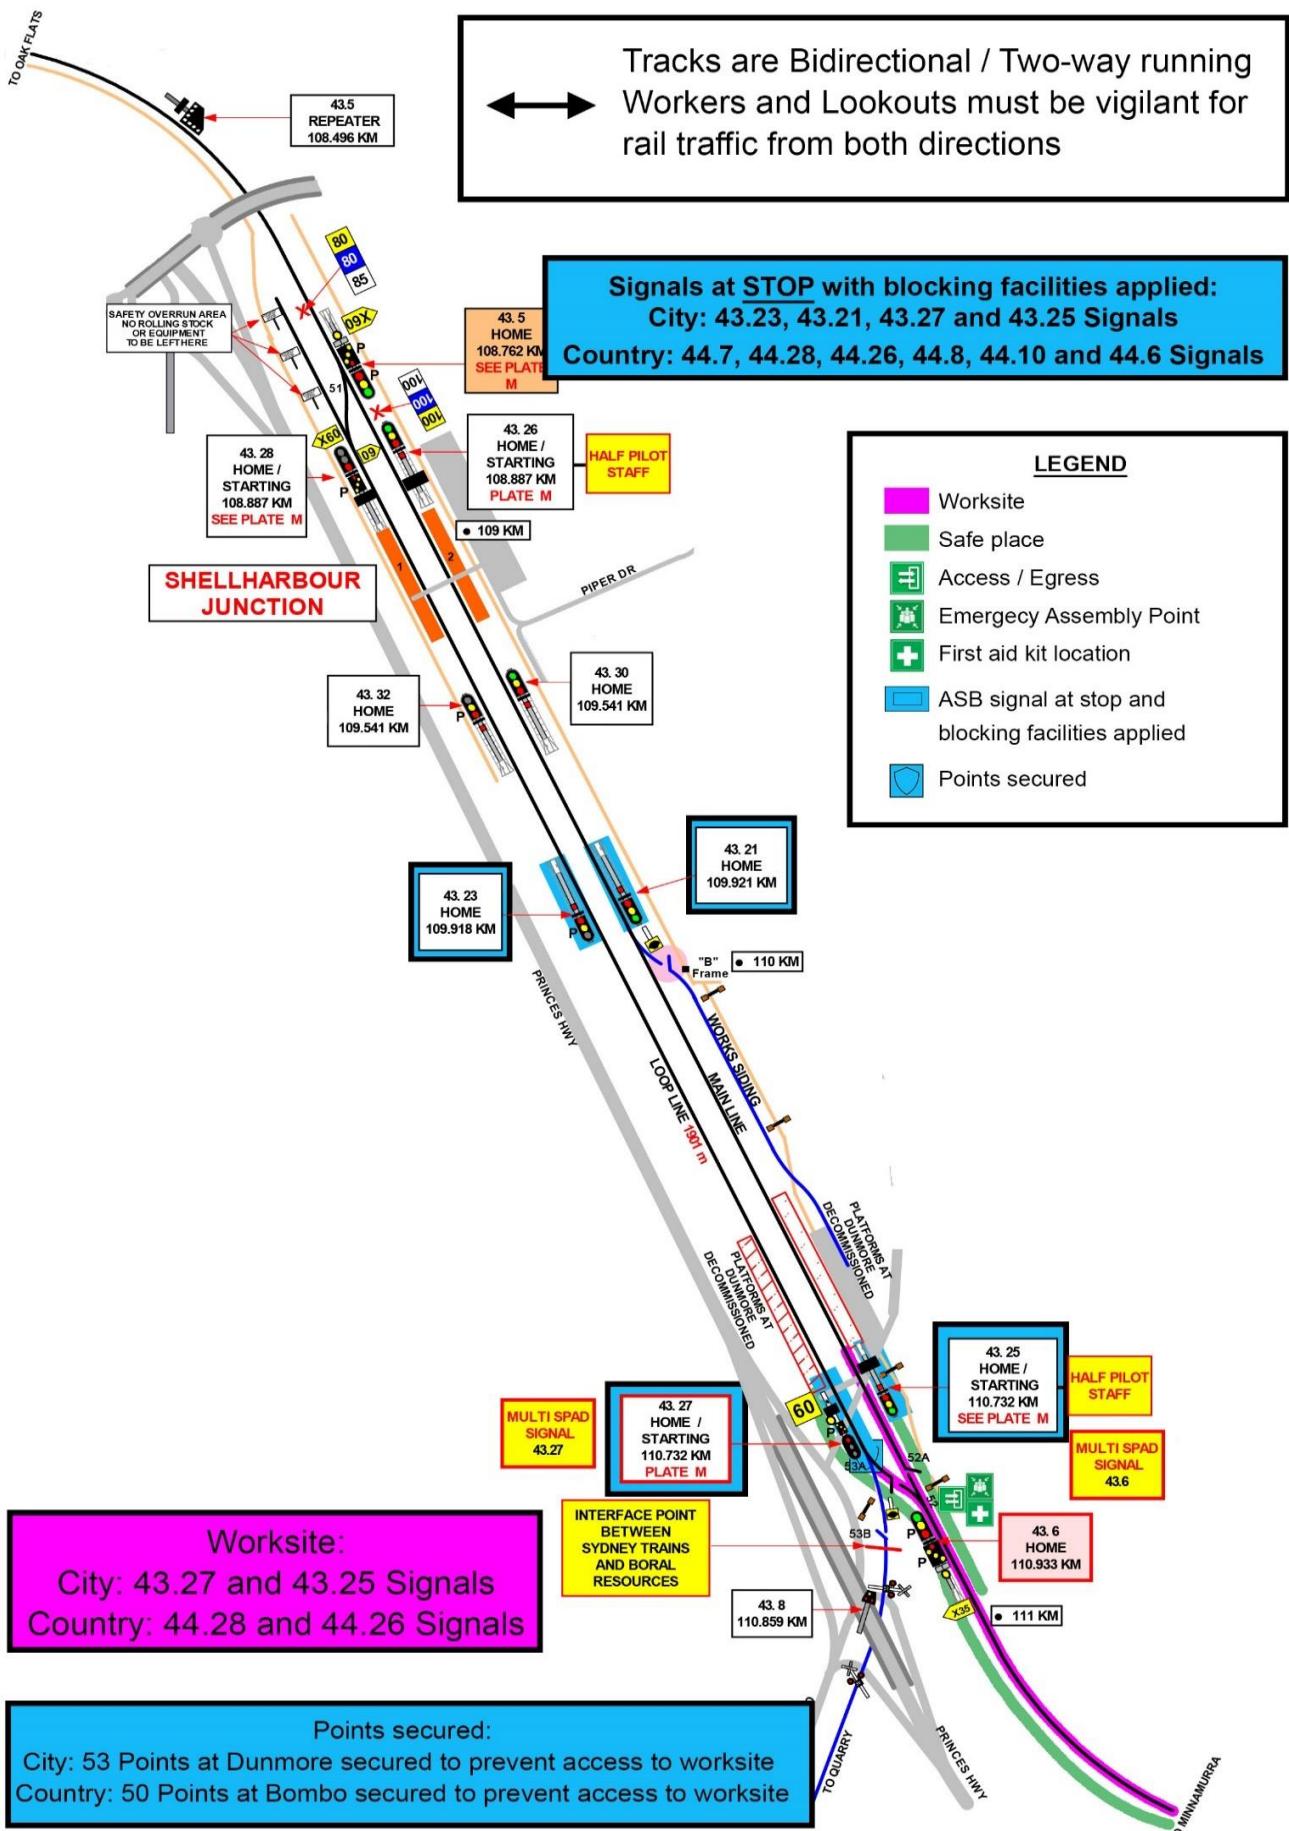


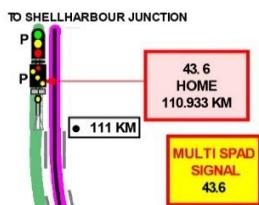

Tracks are Bidirectional / Two-way running
Workers and Lookouts must be vigilant for rail traffic from both directions

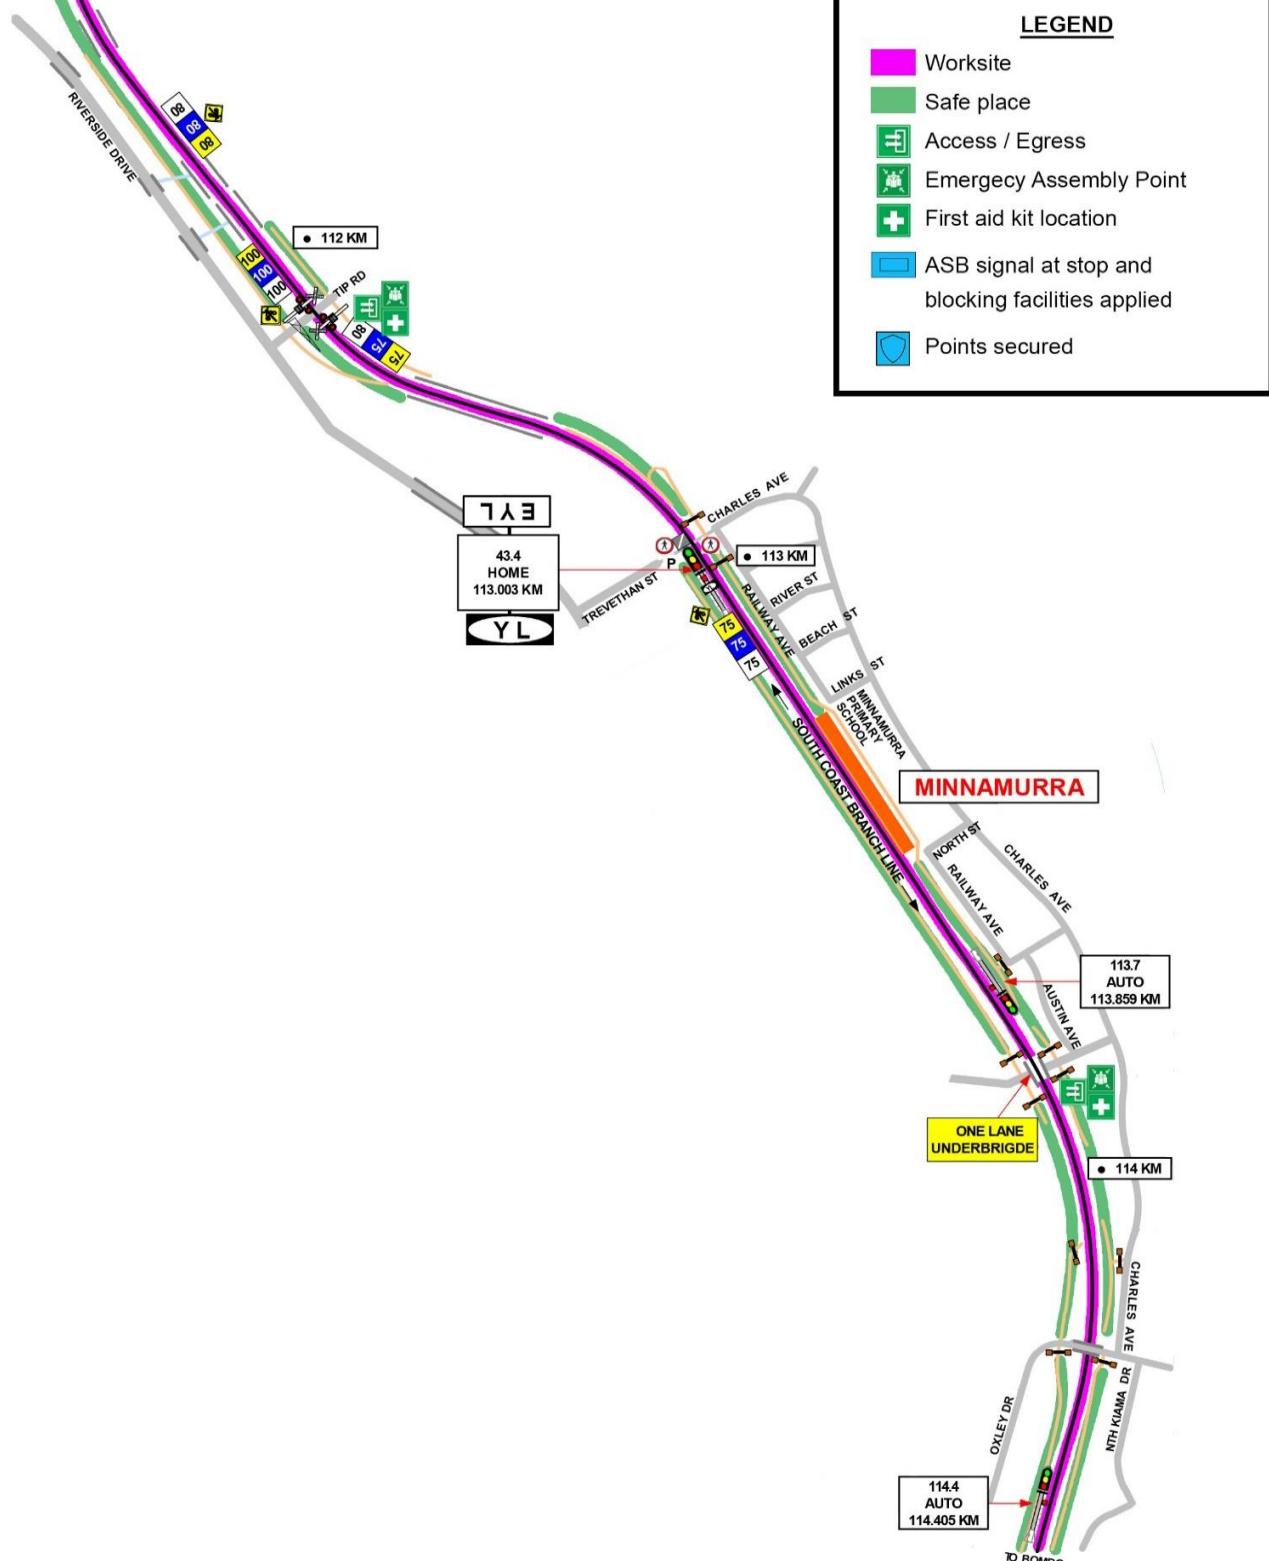

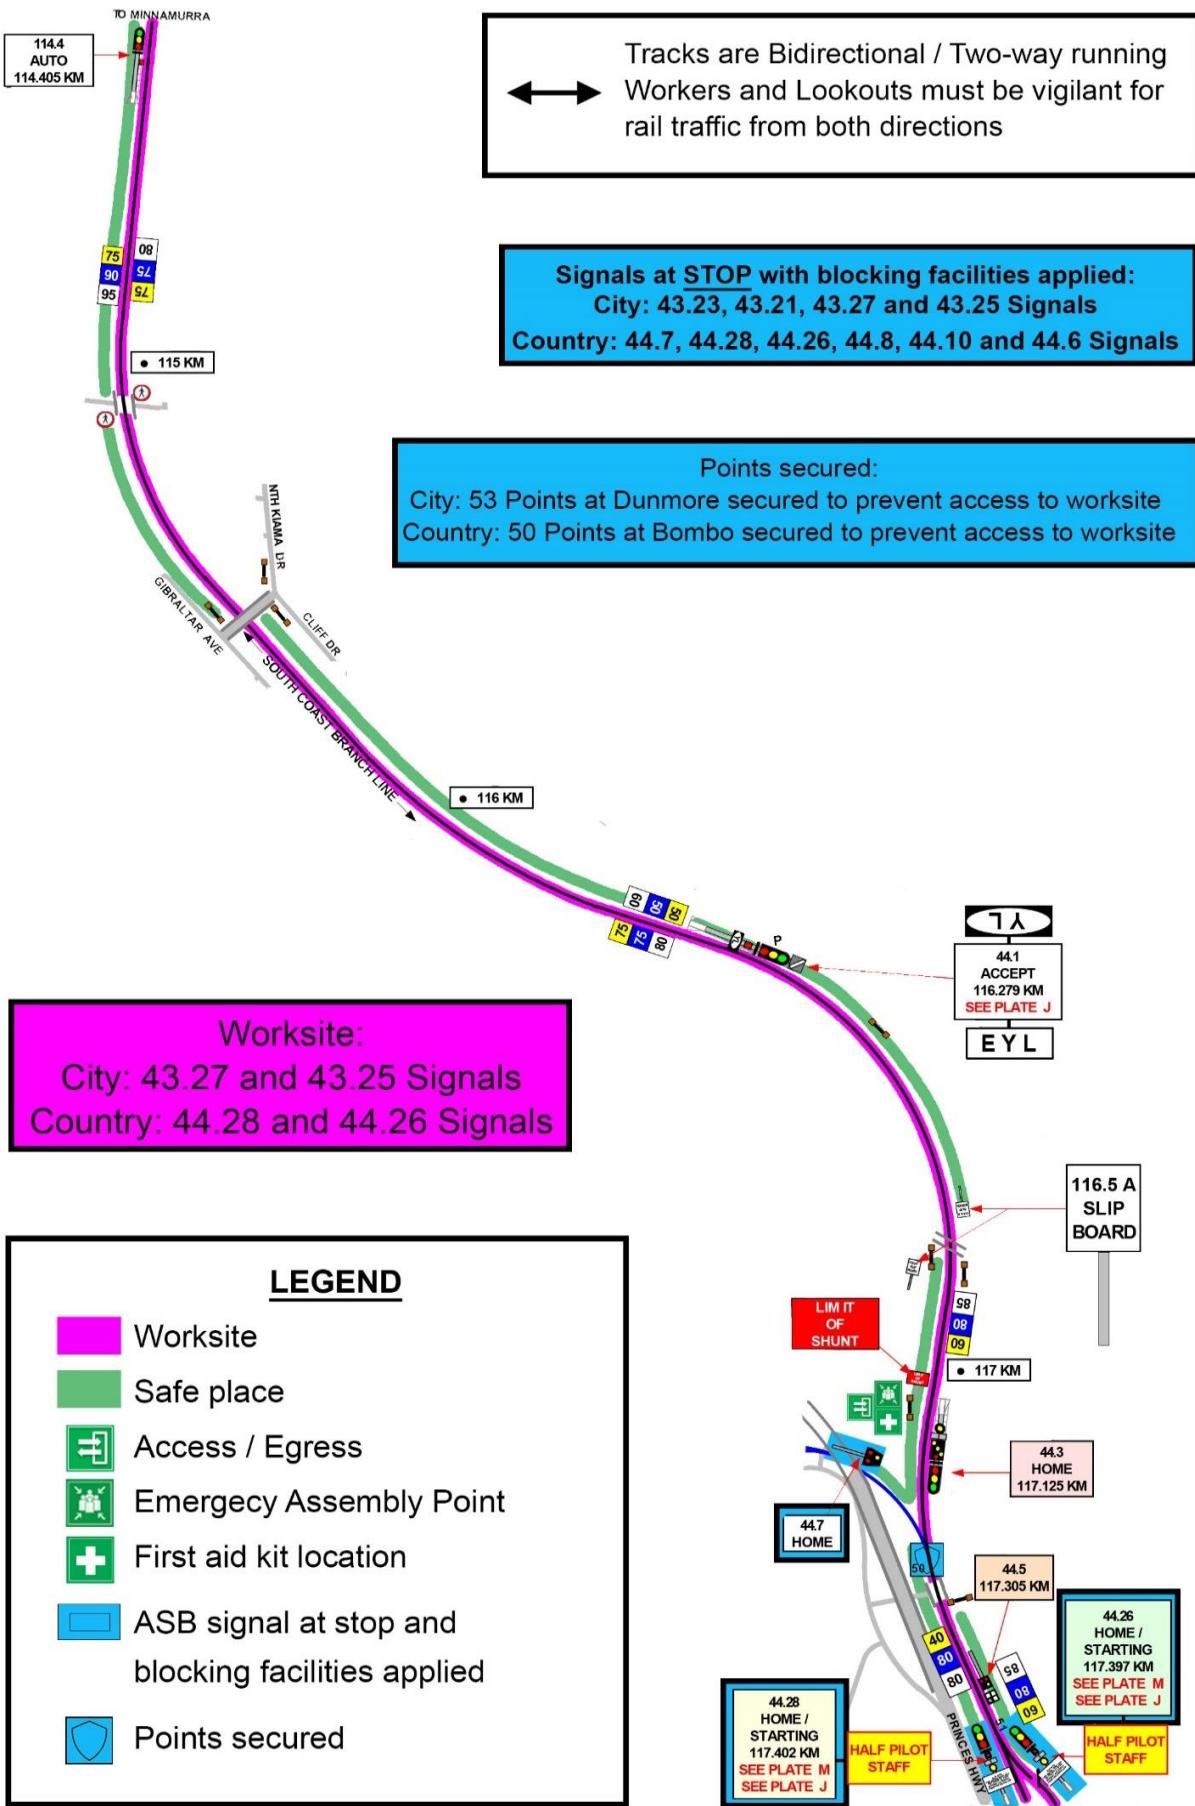

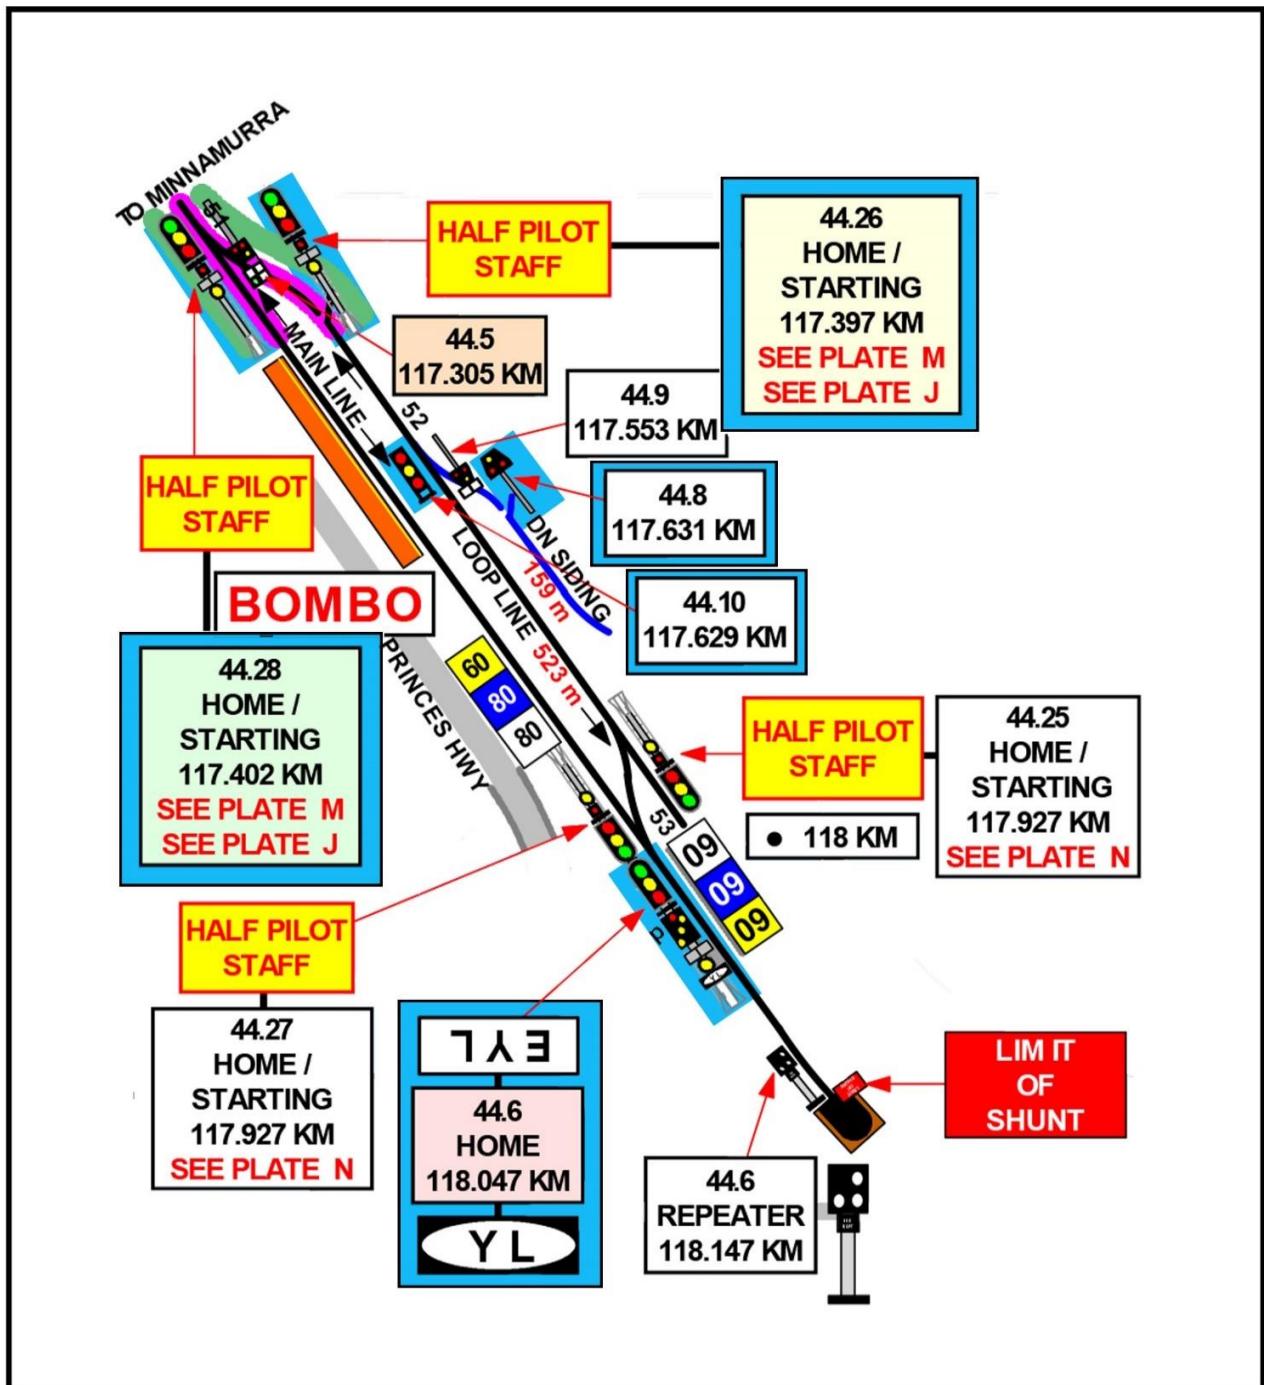

Protection Officer's Diary

UNCONTROLLED COPY WHEN PRINTED



SWI Custodian: Maintenance Planner
SWI Approver: Associate Director Maintenance Operation

OFFICIAL

Version: 1.0
Issue Date: 30/01/2026
Page 12 of 12